OMI TASK CLOSEOUT CHECKLIST

OMI No.		Run No.		Task Control N	lo. (TCN)	
	56444 J-04	/	-	29831	72	
Start	Date	Completion Date		Closure Date		
1.	Deviation Index: Verify total Verify entry is correct into C		ons agree with	index.	QC/Eng.	Date
2.	Constraints: Verify all cons	straints are cleared				
3.	IPR's: Verify that all IPR's or dispositioned as no concentral IPR system and a	straint to OMI closu	re and incorpo	rated in		
4.	Verify that material and eq	juipment requireme	nt list enclosed	(if applicable).		
5.	OMI: Verify that all pages and dated in the lower left			ed, stamped,		
6.	OMI: Verify that all misce number referenced and st	llaneous document tamped; e.g., photo	s/procedures h s, sample resu	ave sequence lts, etc.		
7.	Planned task/OMI satisfac	•				

SSV ICE AND DEBRIS ASSESSMENT

Element/End Item: ALL

Flow/Usage: ET-103 & SUBS

Facility: LC 39

Design Center Concurrence: MSFC, JSC

Category: **B**OPR: **ETM**TTL ORG: **SE**

This document contains HAZARDOUS operations.

OMI S6444 J04 APPROVED

Table of Contents:

1.0 INFORMATION	
1.1 Objective	-
1.2 Special Instructions All Operations	•••••••••••••••••••••••••••••••••••••••
1.3 Operations List	
2.0 SAFETY INFORMATION	
2.1 Hazards	
2.2 Safety Requirements	••••••••••••••••
2.4 Reference Safety Documentation	•••••••••••••••••••
3.0 STAGING REQUIREMENTS	
3.1 Referenced Engineering Documentati	on
3.1.2 Documents (Auto Build Section)	ļ
3.1 Referenced Engineering Documentati	on
3.1.2 Documents	ļ
3.2 Parts, Materials, Equipment, and Spec	ial Tools6
3.2.5 Shop Support Materials	<u> </u>
3.2.8 Personal Protective Equipment	
4.0 PLANNING REQUIREMENTS	8
4.3 LPS Requirements	8
4.3.1 Computer Systems	8
4.4 Support Services, Commodities, and I	equipment8
4.4.2 Communications	8
4.4.3 OTV	8
4.4.4 Countdown Display/Status	9
4.4.8 Services	Error! Bookmark not defined.
4.4.12 Propellants, Gases and Chemical	s9
5.0 CONFIGURATION ACCOUNTING	AND VERIFICATION10
	ed by this TOP10
5.5 List of References	11

1.0 INFORMATION

1.1 Objective

Provide necessary tasks that document, monitor and evaluate ice and debris conditions to eliminate or minimize debris concerns of the integrated SSV during ET tanking, FRF, launch, and associated detanking.

Description

- 1. This OMI is performed as subtask to S0007/S0014/S0037.
- 2. This OMI provides documentation of ice/debris activities:
 - A. Pre-launch icing briefing
 - B. Pre-launch debris inspection
 - C. Countdown Based timeline evaluation monitoring of ET TPS surfaces using OTV
 - D. OTV monitoring of seal/flange areas for cryogenic leakage
 - E. SSV OTV monitoring for debris conditions during countdown
 - F. Cryogenic replenish inspection for evaluation of SSV and facility debris concerns or anomalies
 - G. Evaluation of concerns/anomalies in the event of ET detanking
 - H. Review of engineering film data for \$SME ignition, launch, ascent, ET separation, and orbiter landing.
- 3. Orbiter landing debris information is contained in the NASA publication for Ice and Debris Assessment. That report is referenced in this OMI for continuity of debris data.

1.2 Special Instructions All Operations

- 1. This OMI is run as a subtask to OMI's S0007, S0014, and S0037. All PAD clearing and controlled access operations will be performed per those OMI's.
- 2. Constraints will be statused by controlling OMI's S0007/S0014/S0037.
- 3. The OTV camera numbering scheme for PAD A/B is 0XX/1XX.
- 4. Task Team Leader assignment: NASA PH-H is TTL for L-20 Hour Walkdown, Final Inspection, and Post Launch/Drain Walkdown. ETM is TTL for all other operations.
- 5. From time stable replenish mode starts until start of final SCAN, scanning with individual cameras should be performed approximately once per hour.
- 6. Cameras 061/161, 063/163, and 070/170 may be released to NASA select with CICE concurrence.
- 7. All personnel participating in final inspection and post drain walkdown shall be current in following training:
 - A. Emergency PAD egress
 - B. Fire fighting
 - C. ELSA
- 8. Milestones:
 - A. MLP portion of post launch walkdown commences at approximately T + 1 hours.
 - B. PAD acreage portion of the post launch walkdown commences at approximately T + 2 hours. (may be deferred until preferred daylight hours.)
 - C. Post drain walkdown commences at approximately T + 4 hours after drain initiated (typically 1 1/2 hours after LH₂/LO₂ low level sensors dry).
- 9. Hands-on investigation required for all ET-TPS defects suspected of violating NSTS 08303 ice/debris inspection criteria.
- 10. From time launch scrub is declared until 1.5 hours past time LH₂/LO₂ low level sensors read dry, OTV camera scanning shall be performed approximately once per hour.

- 11. OTV cameras 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 068/168, 069/169, 070/170, and 071/17 shall be used to monitor LO₂/LH₂ tank drain operations.
- Excessive vapors are defined as being more severe than that described in NSTS 08303 - Ice/Debris Inspection Criteria or NSTS 16007 - Launch Commit Criteria -Hazardous Gas Subsystem.
- 13. Quality coverage is not required for performance of this OMI. Ref SFOC-GO0007, Ice and Debris Team Operations are exempt from quality coverage. The ROR (CTIF) performs the CMQC function for all non-hazardous operations.
- 14. Personnel using Sony DKC-ID1 camera shall verify lithium ion battery is securely locked in the bayonet fitting and the lithium button battery door is securely locked and taped in place.
- 15. Verify camera flash is deactivated.
- 16. Personnel using Kodak DC 50/120 camera shall verify alkaline batteries are properly installed.
- 17. Personnel using digital cameras shall not operate in H_2 leak or O_2 rich environment (23 percent or greater).
- 18. Personnel using the Sony MVC-FD91 camera shall verify the lithium ion battery is securely locked and the battery door is locked closed. Personnel shall verify that both battery doors (lithium ion and lithium button) are closed and taped shut.
- 19. Personnel shall verify that cameras and equipment are securely tethered when at the PAD while the SSV is present.

1.3 Operations List

	Operation	Shop/ Cntl Rm Console	OPR	Haz (Y/N)	Duration (Hrs)
No.	Title				
10	Support Preparations	STM/ FR2	ETM	N	0.2
15	IR Camera Setup	PH-H/ NA	ETM	N	4.0
20	Ice Prediction Briefing	SE/ NA	ETM	N	0.5
30	Pre-launch Walkdown	SE/ NA	ETM	N	2.0
40	Ice Frost Debris Console Initial Configuration Setup	SE/ FR2	ETM	N	3.0
50	SSV Debris Assessment	SE/ FR2	ETM	N	18.0
60	Group 1 Monitoring LO2 Chill Down Thru T-0	SE/ FR2	ЕТМ	N	15.0
70	Group 2 Monitoring - LH2 Chill Down Thru T-0	SE/ FR2	ЕТМ	N	15.0
80	Final Inspection	SE/ FR2	ETM	Y	3.0
90	LO2/LH2 Drain Monitoring	SE/ FR2	ЕТМ	N	4.0
100	Console Securing	SE/ FR2	ETM	N	0.5
110	Summary Tape	SE/ FR2	ETM	N	18.0
120	Post Drain Walkdown	SE/ NA	ETM	Y	2.0
130	Post Launch Walkdown	SE/ NA	ETM	Y	3.0
140	Film Review	SE/ NA	ETM	N	15.0
145	IR Camera Removal	PH-H/ NA	ETM	N	2.0
150	Final Report	SE/ NA	ETM	N	0.5

2.0 SAFETY INFORMATION

2.1 Hazards

Operation

- 1. Working at unprotected heights.
- 2. Walkdown at PAD while SSV is in stable replenish mode.

2.2 Safety Requirements

Operation

- 1. If lightning activity is forecast to be within 5 miles of launch PAD, CTC and SFOC safety shall implement provisions of adverse/severe weather and lightning policy contained in GSOP 5400 Ground Safety Operations Procedures.
- 2. There are no safing/shutdown or evacuation steps required in this OMI.
- 3. Hazardous operations within this subtask OMI will not be started until safety concurrence to proceed has been given per the integrated OMI controlling this subtask.

2.4 Reference Safety Documentation

Number	Rev	Title
KHB 1710.2	LI	KSC Safety Practices Handbook
GSOP 5400	LI	Ground Safety Operating Procedures

3.0 STAGING REQUIREMENTS

3.1 Referenced Engineering Documentation

3.1.2 Documents (Auto Build Section)

3.1 Referenced Engineering Documentation

3.1.2 Documents

OPERATION 120

Document No. Rev

Rev Title

NSTS 08303 (LI) NSTS PROGRAM ICE/DEBRIS

INSPECTION CRITERIA

3.2 Parts, Materials, Equipment, and Special Tools

3.2.5 Shop Support Materials

OPERATION 15			
Part No./Find No.	Nomenclature	Qty	Unit
8305-00-519-3144	Rymple cloth	2	roll
6810-00-543-7915	Isopropyl alcohol	8	ounces
OPERATION 145			
Part No./Find No.	Nomenclature	Qty	Unit
8305-00-519-3144	Rymple cloth	2	roll
6810-00-543-7915	Isopropyl alcohol	8	ounces
6505-00-133-8025	Petroleum Jelly, Vaseline (or equivalent)	1	tube/jar

OMI S6444 J04 APPROVED

3.2.8 Personal Protective Equipment

OPERATION 15 Nomenclature

N-Dex nitril gloves

chemical splash goggles

face shield

Nomenclature **OPERATION 30**

safety harness

lanyard

Nomenclature **OPERATION 80**

safety harness

lanyard

Nomex coveralls with gloves and hoods

ELSA

OPERATION 120 Nomenclature

safety harness

lanyard hardhats

flame retardant coveralls

OPERATION 130 Nomenclature

safety harness

lanyard hardhats

flame retardant coveralls

OPERATION 145 Nomenclature

> N-Dex nitril gloves chemical splash goggles

face shield

4.0 PLANNING REQUIREMENTS

OIR Required Yes [], No [X]

4.3 LPS Requirements

4.3.1 Computer Systems

PC GOAL CCMS Configuration CDS CMS

4.4 Support Services, Commodities, and Equipment

4.4.2 Communications

(Per controlling OMI S0007, S0014 or S0037 unless specified otherwise)

4.4.3 OTV

(Per controlling OMI S0007, S0014 or S0037 unless specified otherwise)

OTV Cameras required: 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 068/168, 069/169, 070/170, and 071/171

OTV Cameras to be recorded: 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 068/168, 069/169, 070/170, and 071/171

OMI S6444 J04 APPROVED

4.4.4 Countdown Display/Status

Display Required	Bldg	Room	Operation Time
Timing	rcc	FR2	Duration of Test
Countdown and GMT	LCC	FR2	Duration of Test

4.4.8 Services

SGS Organization	Operation/Step
LS	10-2
COMM Organization	Operation/Step
COMM	10-1
COMM	50-6
COMM	60-1
COMM	60-3
COMM	60-6
COMM	60-9
COMM	60-11
COMM	70-1
COMM	70-3
COMM	70-6
COMM	70-9
COMM	70-10
COMM	70-11
COMM	90-2
COMM	90-4
COMM	100-2
	•

4.4.12 Propellants, Gases and Chemicals

Commodity	Spec No.	Quantity	Revr	<u>Location</u>	Minimum Press	<u>Delivery</u> <u>Time</u>
GN₂	SES-0073 -6.3-5	Min 750 Cu ft	PH-H 861-3645	Pad 39B Camera Site 2	3000 PSI	1 week prior to

5.0 CONFIGURATION ACCOUNTING AND VERIFICATION

5.1 Specific OMRS Requirements Satisfied by this TOP

OMRS NO.	NOMENCLATURE/ EFFECTIVITY	SEQ-STEP (CAP)
S00E00.021	ET TPS MON DURING DETANK TAF.C	90-005
500E000.641-1 500E00.031	•	90-005 120-002
	PRELAUNCH WEATHER BRIEFING (L-1 DAY) VAF1-90	20-001
S00FB0.005	ET TPS SURFACE MONITORING T23, 27-29, 31-999	50-024
S00FB0.350 (1) L01	MONITOR GO2 VENT HOOD VAF1-90	50-026
S00FB0.360 (1) L01	MONITOR ET/ORB MPS FOR LEAKAGE VAF1-90	-50-024
\$00L00.150 L01	HIGH WIND ET NOSE INSPECTION SAF; C	50-022
S00U00.010 (1) L01	POST LAUNCH SHUTTLE/PAD AREA INSPECTION SAF1-999	130-002
S00U00.011 (1) L01	ENGR REVIEW & ANALYSIS OF LAUNCH FILM SAF1-999	140-001
S00U00.020-A (1) L01	ENGINEERING PAD INSPECTION SAF1-999	80-002
S00U00.020-C (1) L01	INSPECT ORBITER AFT ENGINE SAF1-999	80-002
S00U00.020-D (1) L01	INFRARED SURVEILLANCE SAF1-999	80-002
S00U00.030 (1) L01	PRELAUNCH SHUTTLE/PAD AREA INSPECTION SAF1-999	30-001

OMI S6444 J04 APPROVED

5.5 List of References

OPERATION 20		
Reference No.	Rev	Title
NSTS 16007	(LI)	NSTS Program Launch Commit Criteria - Hazardous Gas
		Subsystem and Appendix F
OPERATION 30		
Reference No.	Rev	Title
80901019010	(LI)	ET Post Build Acceptance and In-Process Rework
		Requirements Manual - Offsite
OPERATION 40		
Reference No.	Rev	Title
79K24576	(LI)	OTV \$ystem Installation, LC 39, Pad A
79K24522	(LI)	OTV \$ystem Installation, LC 39, Pad B
OPERATION 50		
Reference No.	Rev	Title
SPI SP-519	(LI)	OMI and OM Implementation
SFOC GO0007	(LI)	Quality Planning Requirements Document (QPRD)

OMI S6444 J04 APPROVED

OPERATION 10 Support Preparations

Shop: STM

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 0.2

10-1 STM JYVO 138

Verify PAD OTV system is configured to support S6444 as scheduled.

Support: COMM

10-2 STM JSTC 111 JSTC *SCB 114

Verify eight 10-minute ELSA's available at complex J for use by Final Inspection Team (ref S0007/S00|14/S0037).

Support: LS

10-3 STM TBC 136

Operation - Support Preparations complete.

*** End of Operation 10 ***

OPERATION 15 IR Camera Setup

Shop: PH-H

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 4.0

WARNING

Hard hats required on the Pad when SSV is not present.

CAUTION

Exercise care to avoid dropping equipment, fasteners, etc from RSS Roof to prevent damage to equipment or injury to personnel. All tools must be tethered.

NOTE

IR Camera installation at RSS Roof site may be not performed if IR Camera already installed or if technical concerns preclude such.

- 15-1 Install IR camera at RSS Roof Site as follows.
 - 1. Rotate camera housing back cover to open position by removing bolts with flat washers (20 pl). Retain bolts/washers for reinstallation.
 - 2. Remove camera housing front cover by removing fasteners (2 pl).

 Reinstall fasteners after cover removal. Retain cover for reinstallation after IR Camera Unit removal.
 - 3. Install IR Camera Unit into camera housing. Secure IR Camera Unit in housing by locking spring pin at lower, left.

WARNING

Power cable is live. Care should be exercised when connecting power cable to avoid electric shock.

CAUTION

Do NOT allow opened back cover to exert undue force on cables once cables have been connected.

4. Connect:

- OTV coaxial cable
- Pan & tilt cable
- Controller cable
- Power cable
- 5. Rotate camera housing back cover into closed position. Secure back cover by installing bolts/flat washers (20 pl). Tighten bolts wrench tight.



WARNING

Isopropyl Alcohol is flammable and is a skin, eye and respiratory tract irritant that affects the central nervous system. Ensure adequate ventilation, avoid inhalation of vapors and do not use near heat, sparks or open flame. Skin contact may cause redness and pain eye contact will cause severe eye irritation and may result in permanent damage. Inhalation of vapors in high concentrations has a narcotic effect on the central nervous system. Personnel shall wear N-Dex nitril gloves and chemical splash goggles. When working at eye level or above wear a face shield over goggles.

WS002.a 05-22-01

- 6. Clean IR Camera Unit lens plate using (1) roll 8305-00-519-3144 Rymple cloth dampened with (4) ounces 6810-00-543-7915 Isopropyl alcohol
- 7. Perform functional checkout of IR Camera Unit using local controller if required at Task Team Leader (TTL) discretion.

	Sub Step Not Performed: 05
NASA PH-H _	Date
USA ETM _	Date
	Not Performed: [ET] 1-13-03

NOTE

IR Camera installation at Camera Site 2 may be not performed if IR Camera already installed or if technical concerns preclude such.

15-2 Install IR camera at Camera Site 2 as follows.

- 1. Rotate camera housing back cover to open position by removing eight ea bolts using Phillips screwdriver. Retain bolts/washers for reinstallation.
- 2. Remove camera housing front cover by removing securing bolt(s). Reinstall bolt(s) after cover removal. Retain cover for reinstallation after IR Camera Unit removal.
- 3. Install IR Camera Unit into camera housing. Secure IR Camera Unit in housing by tightening set screw(s) wrench tight at lower left/right.

WARNING

Power cable is live. Care should be exercised when connecting power cable to avoid electric shock.

4. Connect:

- OTV coaxial cable
- Pan & tilt cable
- Controller cable (2 pl)
- Power cable
- 5. Rotate camera housing back cover into closed position. Secure back cover by installing bolts (8 pl). Tighten bolts using Phillips screwdriver.



WARNING

Isopropyl Alcohol is flammable and is a skin, eye and respiratory tract irritant that affects the central nervous system. Ensure adequate ventilation, avoid inhalation of vapors and do not use near heat, sparks or open flame. Skin contact may cause redness and pain eye contact will cause severe eye irritation and may result in permanent damage. Inhalation of vapors in high concentrations has a narcotic effect on the central nervous system. Personnel shall wear N-Dex nitril gloves and chemical splash goggles. When working at eye level or above wear a face shield over goggles.

WS002.a 05-22-01

- 6. Clean IR Camera Unit lens plate using (1) roll 8305-00-519-3144 Rymple cloth dampened with (4) ounces 6810-00-543-7915 Isopropyl alcohol
- 7. Perform functional checkout of IR Camera Unit using local controller if required at Task Team Leader (TTL) discretion.

	Sub Step Not Performed:
	1-13-03
NASA PH-H _	Date
USA ETM _	N/ A Date
-	
	Not Performed: 15
	1-13-03

*** End of Operation 15 ***

OPERATION 20 Ice Prediction Briefing

Shop: SE

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 0.5

NOTE

Ref: NSTS 16007 (LI) NSTS Program Launch Commit Criteria - Hazardous Gas Subsystem and Appendix F defines the ET No-Ice Zone.

20-1 CICE

Conduct L-1 day ice prediction briefing with launch director

PH-H Signature

OMRSD S00FA0.900

20-2 Operation - Ice Prediction Briefing complete.

*** End of Operation 20 ***

14.07, Eller

OPERATION 30 Pre-launch Walkdown

Shop: SE

Cntrl Rm Console: NA

OPR: ETM
Zone: PAD
Hazard (Y/N): N
Duration (Hrs): 2.0

WARNING

Personnel working at heights greater than 4 feet and within 6 feet of an unguarded edge shall wear a safety harness with a lanyard secured to an approved tie off point, substantial structural member (no handrails) or a properly installed life line.

NOTE

This operation is performed at approximately L-20 hours. When this operation is performed in support of a 24 hour scrub turnaround, the preceding launch scrub post drain walkdown and this pre-launch walkdown may be performed concurrently.

Inspections may also be performed from the RSS, GO₂ Vent Arm (GVA), -Y OWP, or +Y OWP if still extended and accessible.

Ref: 80901019010 (LI) ET Post Build Acceptance and In-Process Rework Requirements Manual - Offsite

NASA ET Mechanical Engineer (PH-H) or designee shall function as team leader. Following personnel are optional walkdown participants.

NASA Engr	(4)
SFOC Engr	(2)
LMSSC - LSS	(1)
Boeing - LSS	(1)
SRB ELE	(1)
Thiokol - LSS	(1)

1603

- 30-1 Debris inspection team **perform** walkdown of SSV and MLP per following:
 - 1. Team leader verify S6444 pre-test briefing complete.
 - 2. Assemble following essential personnel

NASA PH-H Engineering - 1 SFOC ETM Engineering - 1

3. Inspect following areas (as a minimum) from the MLP, RSS and FSS to identify/ resolve potential debris sources.

Areas to be inspected

- A. Launch vehicle external surfaces
 - Orbiter
 - SRB's
 - External Tank
- B. MLP surfaces
 - LH and RH SRB holddown posts
 - Deck including deck bolts, fixtures, and edge gutters
 - SSME LH and RH SRB exhaust openings, and sound suppression (SS) troughs
 - TSM's and camera housings
- 4. Ref Table 30-1, **document** and SIM Photograph SSV and Launch PAD Configuration.

Description: Pre launch walkdown.

OMRSD S00U00.030-1

SPC No. <u>5743</u>/5/170

Disc/Frame Nos: 1-29 / 1-63

1-16-07

Record all facility discrepancies in S0007. Submit copy to PAD leader and notify TBC/CTC. Verify no constraints to continue. Forward description(s) of debris found to SFOC QC for entry into Processing Debris / FOD Database.

PH-H Jamento Olin Date 1/15/23

ETM Ton Food Date 1.15.03

FORD

30-3 Operation - Pre-launch Walkdown complete.

OMI S6444 J04 APPROVED

	P	hotos from MLP	
<u>Photo</u>	Camera Orientation	Lens	Notes
ET -Z	Vertical	28 mm	
Aft Dome	Horizontal	28 mm	
Aft Dome	Horizontal	35-70 mm	
LH SRB from North	Horizontal	35-70 mm	All water troughs in view
LH SRB from North	Vertical	35-70 mm	3-4 water troughs in view
LH SRB from East	Vertical	35-70 mm	
RH SRB from North	Horizontal	35-70 mm	All water troughs in view
RH SRB from North	Vertical	35-70 mm	3-4 water troughs in view
RH SRB from West	Vertical	35-70 mm	
SRB Heater Elec T-0	Horizontal	35-70 mm	Foam intrusion; May need flash
North HDP	Vertical	35-70 mm	Representative view
South HDP	Vertical	35-70 mm	Representative view
ГЅМ Т-0 LH ₂	Vertical	35-70 mm	Flash needed
ΓSM T-0 LO ₂	Vertical	35-70 mm	Flash needed
Orbiter Left & Right Wing	Vertical	35-70 mm	From below ET (1 Photo each wing)



OMI S6444 J04 APPROVED

135 Ft Level Photos

Photo	Camera Orientation	<u>Lens</u>	Notes
LO ₂ UMB	Vertical	35-70 mm	From OWP usually during T5401
LH ₂ UMB	Vertical	35-70 mm	From OWP usually during T5401

215 Ft Level Photos

Photo	Camera Orientation	Lens	<u>Notes</u>
ET surfaces from FSS	Vertical	35-70 mm	
LH SRB Frustrum and FWD skirt	Vertical	35-70 mm	
RH SRB Frustrum and FWD skirt	Vertical	35-70 mm	
Jack Pad C/O's	Horizontal	35-70 mm	Flash needed (1 each C/O)
LO ₂ Ogive Cable Tray	Vertical	35-70 mm	From RSS roof

255 Ft Level Photos

Photo	Camera Orientation	Lens	Notes
ET surfaces with GO ₂ vent ducts in view	Vertical	35-70 mm	
GO ₂ vent ducts	Horizontal	250 mm	

*** End of Table 30-2 Photo Requirements for SSV and Launch Pad Configuration

*** End of Operation 30 ***



OPERATION 40 Ice Frost Debris Console Initial Configuration Setup

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 3.0

NOTE

The next step sets up the photo processing laptop for use in the Firing Room. This is not a constraint to set up of the console or to final inspection team operations. Network or equipment failures on the photo processing machine shall be annotated below.

40-1 Configure computer to perform image processing, analysis, and recording:

- 1. Connect following equipment at Ice/Frost console:
 - power cable to computer
 - "Dazzle" capture card to laptop parallel port
 - "Y" adapter to laptop PS2 port
 - keyboard to keyboard port on "Y" adapter
 - mouse to mouse port on "Y" adapter
 - monitor to laptop
- 2. Insert Xircon Network Card into Personal Computer PCMCIA port.
- 3. Connect ethernet (gray) cord to Xircon Network Card.
- 4. Remove terminator from video cable.
- 5. Plug BNC-to-RCA adapter into end of video cable.
- 6. Plug video cable into "Dazzle" DVC "video in".
- 7. **Power-up** Trouble Console VCR.



8.	$\textbf{Log-on} \ \text{to KSC Ground Ops.}$	Click-on Start/Programs/Dazzle.

9.	Confirm abo	ve equipment a	s operational	and record results.
----	-------------	----------------	---------------	---------------------

Results All systems Functional New Machine with sims & wave on Liga

NOTE

The next step verifies the setup of the infrared scanners. This is not a constraint to set up of the ice console. IR scanner condition shall be annotated below.

Verify IR scanner operation condition, annotate below. 40-2

CS 2: 0K

NOTE

The next step verifies the operation of console monitors in the Firing Room. This is not a constraint to set up of the console or to final inspection team operations. Equipment condition shall be annotated below.

Verify console condition by powering on monitors and tape recorders. 40-3

Monitors: ME /-15-03

Tape recorders: ME /-15-03

NOTE

ET OTV pre-mapping/initial position of cameras may be performed in random order.

Ref: 79K24576 (LI) OTV System Installation, LC 39, Pad A and Ref: 79K24522 (LI) OTV System Installation, LC 39, Pad B define OTV camera locations.

FOV designates field-of view. RSS and -Y OWP must be retracted for completion of pre-mapping.

Pre-mapping steps/substeps in the remainder of this operation need not be performed if supporting a scrub turnaround and if performed during a previous run.

It is preferred to record all pre-mapping scanning on a single tape. However, multiple tapes may be used when lighting/launch countdown constraints necessitate such.

40-4 CVM1 JTV1 223

Perform OTV pre-mapping of External Tank exterior surfaces using OTV Cameras 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, and 067/167 as follows:

- Insert designated pre-map tape into trouble console VCR.
- Punch-up camera number on trouble monitor.
- Start recording on pre-map tape. Record start time (GMT).
- Scan from top-to-bottom, left-to-right and right-to-left at approximately full zoom-in.
- Stop recording on pre-map tape. Record stop time (GMT).
- Record data in Table 40-1.
- Repeat with each OTV camera listed until each has been used to scan the External Tank.
- Remove pre-map tape from trouble console VCR.

up iupo i		
ETM .	[Z][m]	Date
		Not Performed: WA

40-5 CVM1 JTV1 223

Position OTV Cameras 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 070/170, and 071/171 to initial positions as defined in Table 40-2.

ETM _____ Date 1.16-e3

Not Performed: NA

1007

OMI S6444 J04 APPROVED


Table 40-1 ET	Pre-Mapping Data		Tape #
OTV	Start Time (GN	1 T)	Stop Time (GMT)
Camera		,	
004 / 104	22:26		22:32
009 / 109	22:32	!	22:36
013 / 113	22: 36		22:42
033 / 133	22: 42		22:48
042 / 142	22:48		22:52
054 / 154	22: 52		22:56
055 / 155	22: 54		23.00
056 / 156	23:00		23:03
060 / 160	23:03		23:08
061 / 161	23:08		25: 14
062 / 162	23: 14		23: 20
063 / 163	23: 20		23:26
064 / 164	23:26		23:3/
065 / 165	23:31		23.36
066 / 166	23:36		23:38
067 / 167	23:38		23:43

Notes:	NONE		
			•
In the second se			



vec 20 m2

Table 40-2	OTV Camera Initial Positions
OTV Camera	Initial Position
/ 004 / 104	FOV centered on GUCP
+ 009 / 109	FOV on LH ₂ Umbilical including ET/Orbiter interface. Vary close-up and wide angle views with 063/163 and 064/164.
013/113	Full zoom in. View SW GO ₂ Vent Louver area.
033 / 133	FOV perpendicular to ET and with LO ₂ -to-Intertank splice at frame top and LH ₂ -to-Intertank splice at frame bottom. Then tilt down until XT2058 is in frame center.
042 / 142	FOV centered on Orbiter Access Arm-to-Orbiter interface.
054 / 154	FOV to encompass approximately 3 feet forward of XT2058 to 2 feet aft of XT2058. Orbiter wing and SRB should be in view at frame left.
055 / 155	Set FOV on north bridge LH ₂ pipeline flange.
056 / 156	FOV with LH ₂ Aft Dome in frame bottom and XT2058 in view at frame top.
060 / 160	Full zoom in. View SW GO ₂ Vent Louver area:
061 / 161	Full zoom-in. Adjust FOV until ET LO ₂ -to-Intertank splice is centered vertically and view is perpendicular to ET. Pan right until edge of the ET comes into view. Note: LO ₂ Tank may pass out-of-view.
062 / 162	Full zoom in. View NW GO ₂ Vent Louver area.
063 / 163	FOV on LH ₂ Umbilical including ET/Orbiter interface. Vary close-up and wide angle views with 009/109 and 064/164.
064 / 164	FOV on LH ₂ Umbilical including ET/Orbiter interface. Vary close-up and wide angle views with 009/109 and 063/163.
065 / 165	Full zoom out. Set FOV on aft part of ET with frame bottom approximately 2 feet below LH ₂ Aft Dome.
066 / 166	FOV perpendicular to ET with LO ₂ -to-Intertank splice at frame top. Then tilt down until Orbiter RH Wing/SRB intersection is in frame lower right.
067 / 167	Set FOV with LH ₂ Aft Dome toward frame bottom and 2 nd black ring of SRB in view.
070 / 170 071 / 171	Select down wind camera of these two as wide angle view of the SSV. Set up wind camera for close-up view of SSME's.

 

OMI S6444 J04 APPROVED

40-6 Operation - Ice Frost Debris Console Initial Configuration Setup complete.

*** End of Operation 40 ***

/-/6-03 E



E. Cary Raiston Vice President and RSRM Program Manager

January 15, 2003 E600-CY03-010

George C. Marshall Space Flight Center National Aeronautics & Space Administration Marshall Space Flight Center, AL 35812

Attention Ms. Jody A. Singer, MP51

Gentlemen:

Subject:

RSRM-88/STS-107 Transmittal of L-24 Hour PMBT Prediction

This letter officially transmits the L-24 hour propellant mean bulk temperature (PMBT) predicted for STS-107, scheduled for launch on January 16, 2003. The PMBT at the time of launch is predicted to be 60°F which is within the 44° to 86°F requirement. This PMBT prediction is also valid for January 17, 2003.

3

Very truly yours,

F C Raleion

ECR:AL/mp

cc:

T. Boardman, L00 (em)

J. Burn, LD0 (em)

S. Eden, E68 (em)

A. Loveless, E68 (em)

K. Foulger, E62 (em)

S. Henderson, LF0 (em)

M. Kahn, A10 (em)

C. Ralston, E00 (em)

R. Roth, Thiokol/MSFC (em)

D. Ruddell, E68 (em)

D. Burton, K68 (em)

S. Cash, MP51 (em)

ATK Thiokol Propulsion

P.O. Box 707, M/S E00

Brigham City, UT 84302-0707

T. Shaffner, Thiokol/KSC (em)

B. St. Aubin, Thiokol/KSC (em)

Tet 435 863-2258

Fax 435 863-8755

cary.raiston@atk.com

P. Teehan, KSC-SK (em)

D. Wood, MP51 (em)



1-16-0

OMI S6444 J04 APPROVED

OPERATION 50 SSV Debris Assessment

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 18.0

NOTE

Steps in this operation are contingent upon progression of launch countdown operations and may not be performed if countdown is terminated.

Entire Operation Not Performed: NA

NOTE

Until otherwise indicated, all times are referenced to S0007, S0014 or S0037 timelines.

No operations/steps within this subtask OMI may be performed as a stand-alone procedure. This OMI may only be performed as a subtask to \$0007/\$0014/\$0037.

NOTE

Ref: SPI SP-519 (LI) OMI and OM Implementation and Ref: SFOC GO0007 (LI) Quality Planning Requirements Document (QPRD), following step complies with requirements for ROR-as-CMQC function.

50-1

CTIF TBC
TBC CMQC 136

Notify TBC that CTIF will perform the CMQC function for STS 107, S6444 run 1 Request TBC notify CMQC that the RORas-CMQC option will be exercised for STS 167, S6444 run 1.



50-2

CTC TBC 232 **TBC CTIF** 136

Perform OTV and ice/frost monitoring area setups.

50-3

CTIF TBC 136 TBC CTC CTC STM 232

Verify Operation 10- Support Preparations complete.

50-4

CTIF

Verify Operation 20 - Ice Prediction Briefing and Operation 30- Prelaunch Walkdown complete.

16/3/ NO

OMI S6444 J04 APPROVED

50-5

CTIF CVM1 222 CVM1 222

Verify:

- All OTV cameras are on, tapes in recorder, and ready to commence OTV scanning, monitoring, and recording.
- Trouble tape recorder is ready.
- Ice Frost Debris Console Initial Configuration Setup complete.

	ME		11/60
ЕТМ		Date	1/6/03

50-6

CTIF CICE 222

CVM1

CVM2

CIPC

CTIF JYVR 138

CVM1 JTV1 223

CVM2 JTV2 225

All personnel participating in OTV operations report test ready status.

ETM_________Date___//6/13

Support: COMM

1-160

OMI S6444 J04 APPROVED

50-7

CTIF TBC 136 TBC CTC 232

Ice Frost Console Area Setups for OTV scanning complete. Report readiness.

ETM______Date

Date VIO

50-8

CTIF CVM1 222

From start of LO_2 childown until seal deflation/ GO_2 vent hood retraction, **monitor** the +Y/-Y GO_2 vent seal-to-ET interface for seal fretting and continuous GO_2 escape.

OMRS S00FB0.350-1

ETM

1

Date 1 16 83

Not Performed:

1-16-03

N		T	'n
17	U	L	£

GO₂ vent seal fretting could induce damage to ET SOFI. Continuous GO₂ venting could result in formation of ice in the no ice zone (ref NSTS 16007). Ultimate decision to lift the vent hood rests with CMEC.

50-9

CTIF TBC 136 CMEC

If +Y/-Y GO₂ vent seal fretting or continuous GO₂ escape detected from start of LO₂ chilldown until seal deflation, **notify** CMEC for GO₂ vent hood removal.

Not Performed:

50-10

CTIF CIPC 222

Monitor wind speed and direction from start of LO₂/LH₂ chill down through launch/scrub. CIPC notify CTIF if winds measured at 38 knots or greater from North +/-30 degrees as measured at 60 feet.

Not Performed: NA

1-16-03

NOTE

Excessive vapors are defined as being more severe than those described in NSTS 08303 (LI) NSTS Program Ice/Debris Inspection Citeria or NSTS 16007 (LI) NSTS Program Launch Commit Criteria - Hazardous Gas Subsystem.

50-11

CTIF CVM1 222 CVM2

From start of LO₂/LH₂ loading until Prepressurization (LO₂ at T-2M55s and LH₂ at T-1M57s):

- 1. Monitor following ET-Orbiter MPS areas for leakage:
 - LO₂ Feedline (portion external to the Intertank)
 - LH₂ Feedline
 - LH₂ Recirculation Line
 - LH₂ Aft Dome Manhole Cover(s)
 - ET-Orbiter LO₂/LH₂ Umbilical Disconnects
 - LH₂ T-0 Umbilical
 - LO₂ T-0 Umbilical
- 2. Verify no visible cryogenic liquid of excessive vapors.



OMRS-S00FB0.360-1

Not Performed: MA



50-12

CTIF CVM1 222 CVM2

Monitor and videotape following ET TPS surface areas and GO₂ Vent Area during LO₂/LH₂ loading through Prepressurization (LO₂ at T-2M55s and LH₂ at T-1M57s):

- LH₂ Aft Dome
- LH₂ Barrel
- Intertank (external)
- LO₂ Tank
- GO₂ Vent Area
- Protuberances

OMRS S00FB0.005-1

ETN	1 17	Date	1/14/03

Not Performed: Not Performed:

50-13

CTIF 222 CVM1

Perform Operation 60 | Group 1 Monitoring.

Not Performed: N/A ETM

OMI S6444 J04 APPROVED

50-14

CTIF CVM2 222

Perform Operation 70 - Group 2 Monitoring.

ETM MS Date \ \(\bar{17} \) OV

Not Performed:

50-15

CTIF CVM2 222

Once per hour minimum, after start of LO₂/LH₂ (until LO₂/LH₂ low level sensors read dry), scan LO₂ feed line brackets and flange closeouts per Table 50-1.

ETM Date 1/1/06

Not Performed: Not Performed:



OMI S6444 .104 APPROVED

50	11	6

CTIF CICE 222

As count proceeds, for concerns/ observations identified:

- 1. Record observation/concern on trouble tape per Table 50-1.
- 2. Document observed condition on Table 50-2, Observation Worksheet.

Date 1/16/03 **ETM**

Not Performed: NA

50-17

TBC CTIF 136 **CTIF CICE** 222

Perform Operation 80 | Final Inspection when called by S0007/S0014/S0037.

ETM

Not Performed:

			NO	TE			
Final S	SV scan typ	ically com	mences at	L-2 hours.		<u> </u>	
						·	
	CTIF	CVM1 CVM2	222				
	Perform	n final SS	V scan.				
					匝	1	. \
			ETM		05	Date [19/1
						1	
					Not	Performed:	N
		OT IT					
	CTIF	CVM1 CVM2	222				
	At start	of T-9 min	ute hold, c	onfigure O	TV came	eras for term	inal
	count.				IME		
			ETM		M 10	Date	
			ETM		110	_ Date	
					Not 1	Performed:	1/1



OMI S6444 J04 APPROVED

50-20

CTIF

222

Start continuous recording per Table 50-1 at pick-up of T-9 Minute count including following events:

- T-7M30S OAA retraction on camera OTV 008/108 or 042/142.
- T-3M55S Orbiter elevon movement on OTV 009/109, 054/154, 063/163 064/164.
- T-2M30S GOX Vent Seal retraction, +Y /-Y GOX Vent Louvers, and GOX Vent Seal Footprints on OTV 013/113, 060/160, 061/161, 062/162, 068/168, and 069/169.
- T-1M00S through last view of vehicle during ascent on NASA Select (channel 179).

ЕТМ	ME 10 Date	0
	Not Performed:	NA

NOTE

Ref: NSTS 16007 (LI) NSTS Program Launch Commit Criteria - Hazardous Gas Subsystem Appendix F - Ice Launch Commit Criteria defines "No-Go Conditions."

50-21

CICE CTIF 222

Verify there are no Ice Launch Commit Criteria "No-Go Conditions" being violated.

ETM______

Date \ \

50-22

If winds are from the north (+/-30 degrees) and are 38 knots (peak as measured at 60 feet above ground) or greater:

- 1. Monitor/videotape nose cone area during high winds.
- 2. Verify:
 - A. No ice formation on the +Y and -Y GO₂ vent seal footprint areas.
 - B. No damage to the ET TPS at the +Y and -Y GO₂ vent seal footprint areas.
 - C. No damage to the +Y and -Y GO₂ vent seals themselves.
 - D. No evidence of GO_2 leakage from +Y/-Y GO_2 vent seals to ET interface.

OMR\$D S00L00.150

Not Performed:

H603

OMI S6444 J04 APPROVED

50-23

CTIF

Verify launch or launch	scrub (drain back). Record data.
	Launch Scrub NA
	Date 1/16/07 Time 1539 GMT
	Scrub at T-
ETN	ME TO Date \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\

50-24

CTIF

ET-Orbiter MPS monitoring for leakage and ET TPS Surface Areas and GO₂ Vent Area monitoring/recording for launch complete.

Cop Con CC: P Cop (180 1 4 US)

OMRSD S00FB0.005-1 OMRSD S00FB0.360-1

ETM Date ((0)

Not Performed:

1-16-C

NOTE

When completely filled and drain is initiated, it takes approximately 1 hour until the LH₂ tank low level sensors read dry, and approximately 1.5 hours until the LO₂ tank low level sensors read dry.

50-25

CTIF CVM1 222 CVM2

If launch scrubbed (or drain back declared) after start of LO₂/LH₂ slow fill mode:

- Perform Operation 90 LO₂/LH₂ Drain Monitoring.
- **Record** observations/concerns on trouble tape per Table 50-1.
- Document all observations/concerns on Table 50-2 Observation Worksheet.

TM Date 1/16

Not Performed:

50-26 CTIF

 GO_2 Vent seal to ET interface monitoring for seal fretting and continuous GO_2 escape complete.

OMRSD S00FB0.350-1

ETM

Not Performed:

OMI S6444 J04 APPROVED

				O (
50-27	CTIF CVN	I		
	Terminate sca	nning operations.		
		ETM	Date)	/16/03
50-28	CTIF CVN CVN	ı		
	Perform Opera	tion 100 - Console Secur	ing.	
		ETM	Date	16/03
50-29	CTIF			
	If LO ₂ /LH ₂ tanl Tape.	ring started, perform Ope	eration 110 - Summar	ту

ETM

Not Performed: MA

1-16-0. E 50-30

			100E	 		
Fallouina	atan may ha		NOTE	caration		
Following	step may be	not performed	at CIIF of	scretion.		
CTIF TBC	TBC STM	136				
		own to occur at I for duration of			enon lightir	ng be
				Not	Performed	1: NE
	· • • • • • • • • • • • • • • • • • • •	N	ОТЕ			
		pically comme sors read dry.	nces appro	eximately 1.5	5 hours afte	r
	CTIF					
		rubbed after sta 20 - Post-Drair		_	, perform	
		ETM_		WA	_ Date	16/07
				Not 1	Performed	: ME

50-32

50-31

CTIF

If launch occurred, **perform** Operation 130 - Post launch Walkdown.

ETM____

Date_

Not Performed:

1-16-0

OMI S6444 J04 **APPROVED**

50-33

CTIF

If launch occurred, perform Operation 140 - Film Review.

Not Performed: NA

50-34

SSV Debris Assessment complete.

Table 50-1 Observation Documentation Procedure

1.	CTIF	CVM1 CVM2	222	Locate anomaly/concern on pertinent OTV(s)
2.	CTIF			Punch-up pertinent OTV on trouble monitor. Update trouble tape log in table below.
3.	CTIF			Start the trouble tape.

NOTE

Trouble tape shall be allowed to run until sufficient OTV documentation of observation/concern has been made. OK to change OTV's while trouble tape is running.

4 CTIF

After observation/concern has been documented on the trouble tape, stop the trouble tape. Update trouble tape log below.

TROUBLE TAPE LOG

Trouble Tape No.	Start Time (GMT)	Stop Time (GMT)	OTV	Description
0	0813	0818	054	LOZ F/L SCAN
01	0915	0917	054	LOZ F/L SCAN
01	1013	1015	054	LOZ F/L Scan
01	1049	1050	055	AFT Hard Built C/o Lit Statem 2058 (-Y) tinst
01	1120	1122	0054	LOZ F/L Sen
01	1217	1220	Ø054	LOZ F/L Sran +Y LHZ for burn
_01	1258	1300	761	ET I/T Fost in String V
01	1522	1324	054	LOZ FIL SCON
01	1437	1441	054	Loz F/c Sean

TROUBLE TAPE LOG

Table 50-1 Observation Documentation Procedure

Trouble Tape No.	Start Time (GMT)	Stop Time (GMT)	OTV	Description
\rightarrow				
				
<u> </u>	\			
		\ <u></u>		
	 .	\rightarrow		· · · · · · · · · · · · · · · · · · ·
	,			
				
	· · · · · · · · · · · · · · · · · · ·			

*** End of Table 50-1 Observation Documentation Procedure ***

OBSERVATION DOCUMENTATION

Record following information for condition observed:

Observation No				
Observed By:				
Date	Time		GMT	
Camera No. (or Walkdo	wn)			
Description:				
	<u> </u>			
Acceptance Rationale (o.	r IPR/PR No.):			
CIOE		Doto		
CICE				
CTIF		Date		



OMI S6444 J04 APPROVED

Table 50-2 Observation Worksheet

Record following information for conditi	on observed:
Observation No.	
Observed Ry:	
Date Time	GMT
Camera No. (or Walkdown)	
Description:	
Acceptance Rationale (or IPR/PR No.):	
CICE	Date
CTIF	Date

Record following information	for condition obs	served:	
Observation No.			
Observed By:			
Date	Time	GMT	
Camera No. (or Walkdown)			
Description:			
			
Acceptance Rationale (or IPR/P	PR No.):	,	
CICE	Date		
CTIF	Date	;	



Record following information for condition	ion observed:
Observation No.	
Observed By:	
\	GMT
Camera No. (or Walkdown)	
Description:	
Acceptance Rationale (or IPR/PR No.):	
CICE	
CICE	Date
CTIF	Date

OBSERVATION DOCUMENTATION

Record following information for condition observed:

Observation No.			
Observed By:			
Date	Time		GMT
Camera No. (or Walkdown)			
Description:			
Acceptance Rationale (or IPR	/PR No.):		
CICE		Date	
CTIF	· · · · · · · · · · · · · · · · · · ·	Date	



OMI S6444 J04 APPROVED

Table 50-2 Observation Worksheet

Record following information for condit	ion observed:
Observation No.	
Observed By:	
\	GMT
Camera No. (or Walkdown)	
Description:	
	•
Acceptance Rationale (or IPR/PR No.):	
CICE	Date
CTIF	Date

OBSERVATION DOCUMENTATION

Record following information for condition observed:

O1	•
Observation No.	
Observed By:	
Date Time	GMT
Camera No. (ox Walkdown)	
Description:	
Acceptance Rationale (or IPR/PR No.):	
•	
CICE	Date
CTIF	



Record following information for condition	n observed:
Observation No.	
Observed By:	
Date Time	GMT
Camera No. (or Walkdown)	
Description:	
Acceptance Rationale (or IPR/PR No.):	
CICE	Date
CTIF	Date
*** End of Table 50-2 O	bservation Worksheet ***
*** End of Op	eration 50 ***

OPERATION 60 Group 1 Monitoring LO2 Chill Down Thru T-0

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 15.0

NOTE

Do not perform this operation if launch scrub declared before LO₂ Chill Down commences.

Operation Not Performed: N/A

NOTE

This operation monitors LO₂ Ogive and Barrel and associated components/ areas from start of Chill Down through T-0 via OTV cameras 013/113, 060/160, 061/161, 062/162, 063/163 and 064/164.

OTV cameras 013/113 and/or 062/162 will view -Y GO₂ Vent Hood Seal at all times. At no time will both cameras be positioned away from the -Y GO₂ Vent Hood Seal.

OTV cameras 068/168 and 069/169 view SW and NE GO₂ Vent Areas respectively. These are fixed FOV cameras and do not have pan, tilt, etc. capability.

Steps in this operation are contingent upon progression of launch countdown operations and may be not performed if countdown is terminated.



LO₂ Chill Down To L-2 Hour Mark

60-1 CVM1 JYVR 138

At start of vehicle LO₂ Chill Down, **start** recorders for cameras 004/104, 013/113, 060/160, 061/161, 062/162, 063/163, 064/164, 068/168, and 069/169.

ETM . 17 May 100 Date 1/16/03

Support: COMM

60-2 Record LO₂ MPS Chill Down start date and time (GMT).

1/16/03 ET 05 LO₂ MPS Chill Down Date 0805 GMT Time 0805 GMT

ETM MS Date 1/16/03

60-3 CVM1 JTV1 223

From start of LO₂ Chill Down until start of LO₂ Fast Fill on OTV cameras 004/104, 013/113, 060/160, 061/161, 062/162, 063/163, 064/164, 068/168, and 069/169 monitor/videotape ET-TPS surfaces. No cryogenic liquid or excessive vapors allowed.

Support: COMM

Not Performed: N/A

R Brewer Date 01-16-03

Support: COMM

Not Performed: NA

60-4	Record LO ₂ Slow Fill start date and time (GMT).
٠.	LO ₂ Slow Fill Date 1/15/03 GMT Time 0842 GMT
	ETM 17 Date 1/16/03 Not Performed: N/A
	Not Performed: Not Performed:
60-5	Record LO ₂ Fast Fill start date and time (GMT).
٠	LO ₂ Fast Fill Date 1/16/03 GMT Time 0854 GMT
,	ETM MS Date 1/16/0
\$	Not Performed: Not Performed:
60-6	CVM1 JTV1 223
	From start of LO ₂ Fast Fill until LO ₂ stable replenish mode is established, monitor/videotape ET-TPS surfaces on OTV cameras 004/104, 013/113, 060/160, 061/161, 062/162, 063/163, 064/164, 068/168, and 069/169. Scan LO ₂ Tank. Alternate cameras and scan from Intertank to LO ₂ Barrel Splice to GO ₂ Vent Hood. No cryogenic liquid or excessive vapors allowed

E

60-7 Record LO₂ Topping date and time (GMT).

LO₂ Topping Date <u>0/-/6-03</u> GMT Time <u>/0:55</u> GMT

ETM R Brewer Date 01-/6-03

Not Performed: N/A

60-8 Record LO₂ Stable Replenish mode start date and time (GMT).

LO₂ Stable Replenish Date 01-16-03 GMT Time 04-46-03 GMT

ETM R Brewer Date 01-18-03

Not Performed: NA

60-9 CVM1 JTV1 223

From time LO₂ Stable Replenish mode is established until time for final SSV scan (approximately L-2 hours), **monitor**, **scan and videotape** ET-TPS surfaces on OTV cameras 004/104, 013/113, 060/160, 061/161, 062/162, 063/163, 064/164, 068/168, and 069/169. No cryogenic liquid or excessive vapors allowed.

ETM K Brewer Date 0/-/6-03

Support: COMM

Not Performed: NA

(1) STAMPED IN Elfol. RBrewer 55 1-16-03

Final SSV Inspection Scan

NOTE

Final SSV Inspection Scan should begin not later than 1.5 hours prior to start of T-9 minute hold (approximately L-2 hours) to allow ample time to finish. Final SSV Inspection Scan shall include the ET, SRB's and the Orbiter.

Final scan may be altered or partially performed in the event that time constraints will not permit a complete SSV scan prior to start of T-9 minute hold.

During Final SSV Inspection Scan the camera lights on OTV cameras 061/161 and 062/162 shall be turned "Off" when view passes over the Orbiter cockpit to preclude "distracting" the Flight Crew.

60-10 CVM1 JTV1 223

> Perform Final SSV Inspection Scan with OTV cameras 004/104, 013/113, 060/160, 061/161, 062/162, 063/163 and 064/164. Scan passes shall view entire SSV with cameras at approximate full zoom in during final scan.

> > ETM Brewer Date 0/-/6-03
> >
> > Not Performed: 1/A

Terminal Count Camera Positions

NOTE

This step performed for SSME ignition only and may be not performed if launch is scrubbed prior to pick-up of T-9 minute count. Cameras must be positioned for ignition no later than T-9 minutes. "Spot" scanning after pick-up of the T-9 minute count is acceptable with CICE concurrence.

Cameras may be positioned for SSME ignition in an arbitrary order.

Camera positions may be altered real-time with CICE concurrence. Alterations should be determined prior to pick-up of T-9 minute count to allow sufficient time for OTV operators to rehearse camera movements.

CVM1 camera positions for SSME ignition are defined in Table 60-1.

60-11 CVM1 JTV1 223

Ref Table 60-1, **position** cameras 004/104, 013/113, 042/142, 054/154, 060/160, 062/162 for terminal count.

ETM

Date / //6/03

Not Performed:

60-12 Operation - Group 1 Monitoring - LO₂ Chill Down Thru T-0 complete.



Table 60-1 CVM1 Camera Positions for Terminal Count

NOTE

This Table defines CVM1 camera positions for terminal countdown. Cameras should be positioned for ignition no later than pick-up of T-9 minutes count. "Spot" scanning after pick-up of the T-9 minute count is acceptable with CICE concurrence.

Cameras may be positioned for SSME ignition non-sequentially.

Camera positions may be altered real-time with CICE concurrence. Alterations should be determined prior to pick-up of T-9 minute count to allow sufficient time for operators to rehearse camera movements with ice console.

The GO₂ Vent Arm (GVA) retracts at T-2m30s.

CVM1 Camera Positions Are Defined As Follows:

004/104

GUCP centered in frame so that GUCP will stay in view throughout SRB "twang".

042/142

At approximately T-1 hour, view and monitor Orbiter access arm while Orbiter hatch is being closed.

At T-7m30s, watch Orbiter access arm retract, then view bipod strut in center of frame, LO_2 feedline fairing in top of frame, and Orbiter hatch in right of frame.

054/154

At T-3m50s, view Orbiter right hand body flap movement, then zoom out with Orbiter/ET umbilicals at approximate frame center, Orbiter trailing edge at frame bottom, and edge of +Y (RH) SRB just in view at frame right.



Table 60-1 CVM1 Camera Positions for Terminal Count

013/113

At T-2m30s, watch lift of GO₂ vent arm for debris and nose cone/vent louvers for ice damage. Immediately following lift of GO₂ vent arm, center frame on GO₂ vent louver and then zoom-out so that entire ET movement is seen during SRB 'twang' at SSME ignition.

060/160

At approximately **T-2m30s**, after GO₂ vent arm retracts, go full zoom in for a close-up inspection of the GO₂ vent louver. After CICE concurrence, go full zoom out and position camera with SSV centered and ET nose cone at frame top.

062/162

At approximately T-2m30s, after GO_2 vent arm retracts, go full zoom in for a close-up inspection of the -Y GO_2 vent louver. After CICE concurrence, zoom out until ET nose spike is at top of frame with ET centered.

061/161

SEP 18 102

At approximately **T-4m00s**, verify camera lights are off. Then position camera to view astronaut closing visor at T-2 minutes 00 seconds.

068/168 and 069/169

Immediately after GO2 vent hood lift, turn lights off to preclude distracting orbiter crew when the GVA rotates to its latchback position.

063/163

SRB AND ORBITER WING IN VIEW DENTERED OVER LH2 FIREDETECTION
SYSTEM PAPER COUNTY End of Table 60-1 Camera Positions for Terminal Count ***

*** End of Operation 60 ***



OPERATION 70 Group 2 Monitoring - LH₂ Chill Down Thru T-0

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 15.0

NOTE

Do not perform this operation if launch scrub declared before start of LH₂ Chill Down.

Operation Not Performed:

NOTE

This operation monitors LH₂ Barrel and associated components/areas start of LH₂ Chill Down to pre-pressurization via OTV cameras 009/109, 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 067/167.

Steps in this operation are contingent upon progression of launch countdown operations and may be not performed if countdown is terminated.



LH₂ Chill Down To L-2 Hour Mark

70-1 CVM2 JYVR 138

At start of LH₂ Chill Down, start recorders for cameras 009/109, 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 067/167.

ETM 75m foul Date 116.03
Fold Support: COMM

70-2 Record LH₂ Chill Down start date and time (GMT).

LH₂ Chill Down Date 1.16-03 Time 0809 GMT

70-3 CVM2 JTV2 225

From start of propellant loading until start of LH₂ Fast Fill on OTV cameras 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 067/167, monitor/videotape ET-TPS surfaces. No cryogenic liquid or excessive vapors allowed.

ETM_ Tom tord Date 1403

Support: COMM

Not Performed: NA

70-4	Record LH ₂ Slow Fill start date and time (GMT).
	LH ₂ Slow Fill Date 1.16.03 Time 0838 GMT
	ETM 70m Ford Date 1.16.03
	Not Performed: Not Performed:
70-5	Record LH ₂ Fast Fill start date and time (GMT).
	LH ₂ Fast Fill Date 16.03 Time 0857 GMT
	ETM Ton Ford Date 1.10.03
	Not Performed: NA
70-6	CVM2 JTV2 225
	From start of LH ₂ Fast Fill until stable replenish mode is established, scan LH ₂ Tank. Alternate OTV cameras 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 067/167 and scan/videotape from LH ₂ Aft Dome to Intertank.
	ETM Date 1/16/03
	Support: COMM
	Not Performed: N/A

70-7	Record start	date and	time (GMT)	for LH ₂ Topping.

LH ₂ Topping Date_	1/16/03	Time_	1009	_GMT
ETM	MS 17	JAM	Date	103
			rformed:	

70-8 Record LH₂ Stable Replenish mode start date and time (GMT).

LH ₂ Stable Replenish Date_	1/16/03	Time_fo	45 GMT
ETM	MS 17		1/16/03
		Not Perform	ned: N/A

70-9 CVM2 JTV2 225

During LH₂ Stable Replenish mode and until time for final scan (approximately L-1.5 hours), on OTV cameras 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 067/167, monitor/videotape ET TPS surfaces including LO₂ Feed Line, LH₂ Feed Line, LH₂ Recirculation Line, LH₂ Aft Dome and manhole covers, LH₂/LO₂ Umbilicals, and TSM LH₂/LO₂ Umbilicals. No cryogenic liquid or excessive vapors allowed.

ETM	MS 17	Date 1)16/03
		Support: COMM

Not Performed: NA

Final SSV Inspection Scan

NOTE

Final SSV Inspection Scan should begin not later than 1.5 hours prior to start of T-9 minute hold (approximately L-2 hours) to allow ample time to finish. Final SSV Inspection Scan shall include the ET, SRB's and the Orbiter.

Final SSV Inspection Scan may be altered or partially performed in the event that time constraints will not permit a complete SSV scan prior to start of T-9 minute hold.

70-10 CVM2 JTV2 225

Perform Final SSV Inspection Scan with OTV cameras 009/109, 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 064/164. Scan passes shall view entire SSV with cameras at full zoom in during final scan.

ETM_______ Date 1/16/07

Support: COMM

Not Performed: NA



T-9 Minute Terminal Count

NOTE

Next step performed for terminal count only and may be not performed if launch is scrubbed prior to pick-up of T-9 minute terminal count. Cameras must be positioned for SSME ignition no later than T-9 minutes. 'Spot' scanning after pick-up of the T-9 minute terminal count is acceptable with CICE concurrence.

Cameras may be positioned for SSME ignition in an arbitrary order.

Camera positions may be altered real-time with CICE concurrence. Alterations should be determined prior to pick-up of T-9 minute count to allow sufficient time for OTV operators to rehearse camera movements.

CVM2 camera positions for terminal count are defined in Table 70-1.

70-11 CVM2 JTV2 225

Ref Table 70-1, **position** cameras 009/109, 033/133, 056/156, 065/165, 066/166 061/161, 070/170, 071/171 and 067/167 for terminal count.

Support: COMM

Not Performed: NY

70-12 Operation - Group 2 Monitoring - LH₂ Chill Down Thru T-0 complete.



Table 70-1 - CVM2 Camera Positions for Terminal Count

NOTE

This Table defines CVM2 camera positions for terminal countdown. Cameras should be positioned for ignition no later than pick-up of T-9 minutes count. "Spot" scanning after pick-up of the T-9 minute count is acceptable with CICE concurrence.

The Orbiter access arm (OAA) retracts at T-7M30S. Orbiter body flap movement occurs at T-3m50s.

Cameras may be positioned for SSME ignition non-sequentially

Camera positions may be altered real-time with CICE concurrence. Alterations should be determined prior to pick-up of T-9 minute count to allow sufficient time for operators to rehearse camera movements with ice console.

Group 2 Camera Positions Are Defined As Follows:

033/133

Full zoom out. LO₂ feed line in frame center and MLP deck at bottom.

055/155

View ET aft dome with MLP deck just out of view at bottom, ET XT-2058 ring frame at frame top and both SRB's just in view at sides.

<u>056/156</u>

View ET aft dome with MLP deck just out of view at bottom. ET XT-2058 ring frame at frame top and both SRB's just in view at sides.

065/165

Full zoom out. SSV centered. MLP deck edge just in view at bottom.

066/166

ET centered. Intertank to LO₂ Barrel splice at frame top with the majority of Orbiter wing in view.

067/167

Center on GUCP for optimum view.

070/170 and 071/171

At **T-9m00s**, zoom in on space shuttle main engine with camera providing best view. Zoom out on SSME for wide angle view with other camera.

009/109

At approximately **T-3m50s**, position to view Orbiter body flap and elevons movement. Afterwards, center on LH₂ umbilical with -Y vertical strut at frame top.

061/161

At approximately T-1m30s, tilt-up to GO₂ Vent Footprint. Zoom in. Pause. If footprint is acceptable, zoom out and tilt down to view Orbiter nose/cockpit through liftoff.

*** End of Table 70-1 - CVM2 Camera Positions for Terminal Count ***

*** End of Operation 70 ***



OMI S6444 J04 APPROVED

OPERATION 80 Final Inspection

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM
Zone: PAD A/B
Hazard (Y/N): Y
Duration (Hrs): 3.0

NOTE

Final Inspection may not need to be performed depending on LO₂/LH₂ tanking and launch countdown, as determined by CTC/TTL.

Final Inspection Team stay time guidelines for each level are given in Table 80-1. These guidelines are for reference only and may be deviated from at PICE discretion.

Operation Not Performed: MA



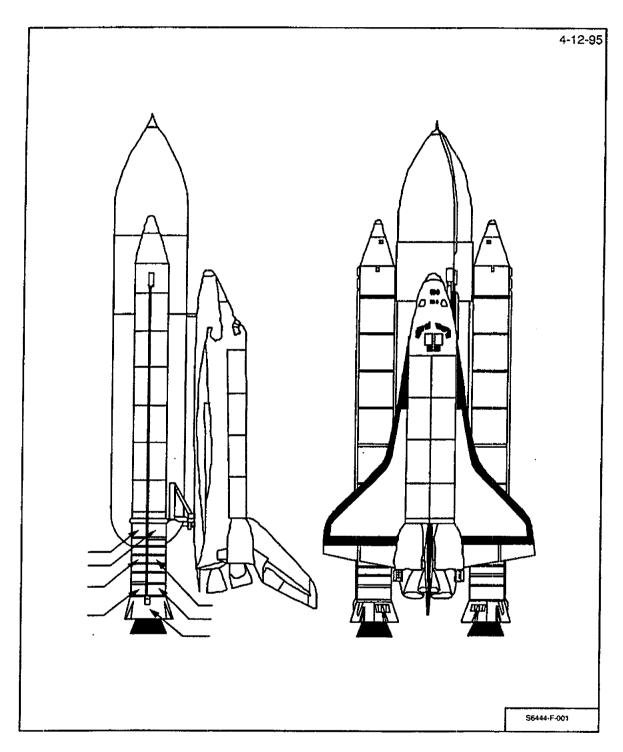


Figure 80-1: Deck (0) Level (For Reference Only)

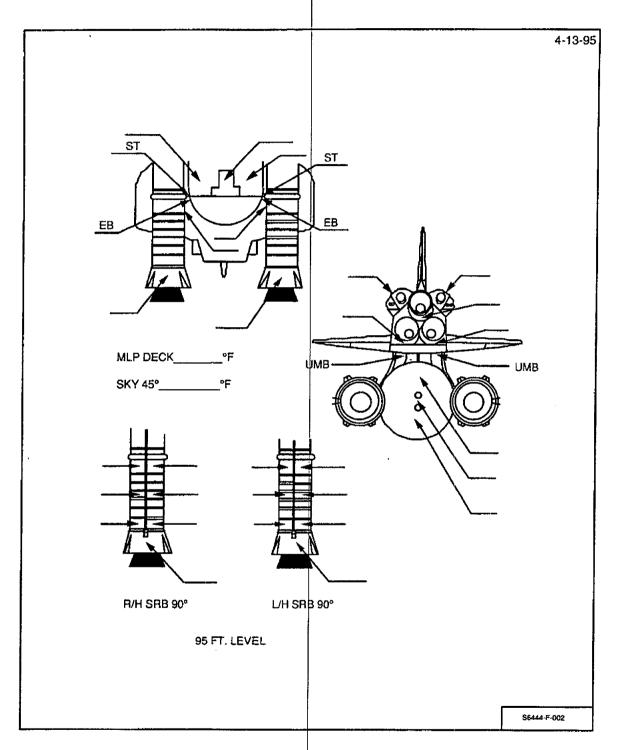


Figure 80-2: Deck (0) and 95 Ft Levels (For Reference Only)

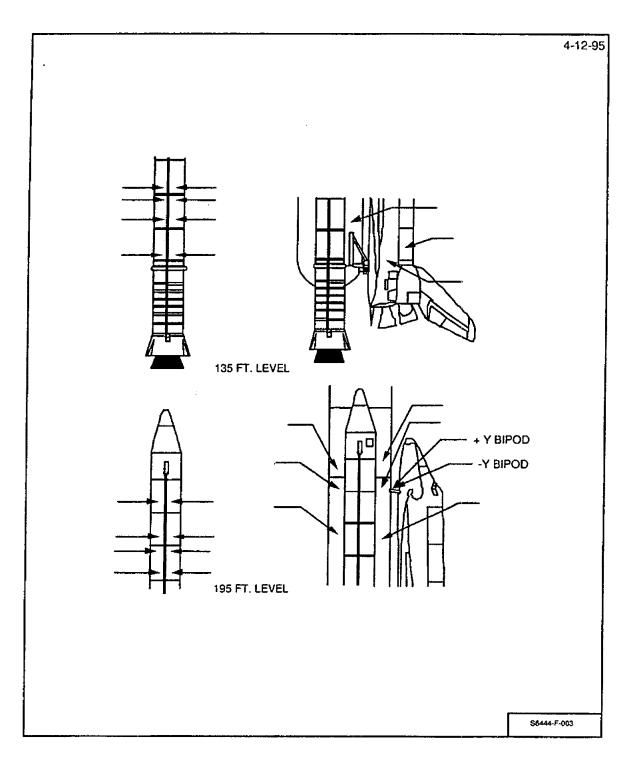


Figure 80-3: 135 and 195 Ft Levels (For Reference Only)

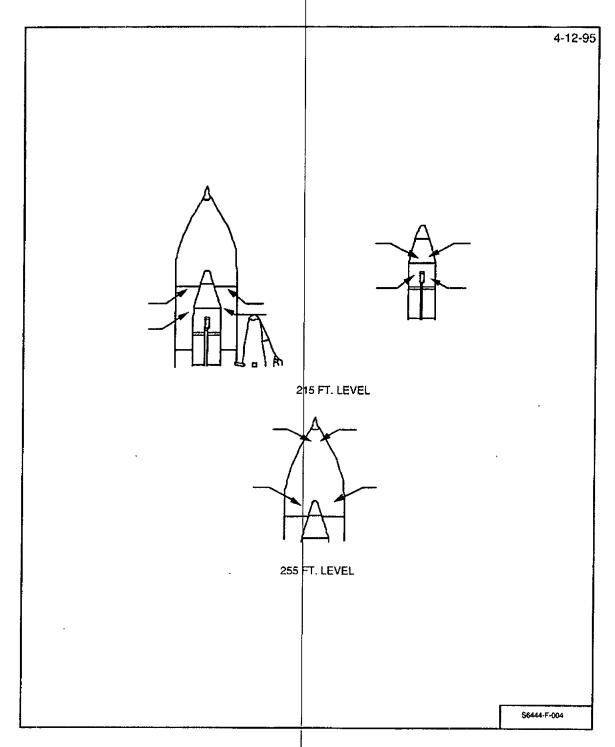


Figure 80-4: 215 and 255 Ft Levels (For Reference Only)

WARNING

Personnel working at heights greater than 4 feet and within 6 feet of an unguarded edge shall wear a safety harness with a lanyard secured to an approved tie off point, substantial structural member (no handrails) or a properly installed life line.

WARNING

Personnel performing final inspection shall be attired in Nomex coveralls with gloves and hoods. Personnel shall have available gloves, hoods, and ELSA at all times during walkdown.

Personnel using Sony DKC-ID1 camera shall verify lithium ion battery is securely locked in bayonet connector and the lithium button battery door is locked and taped in place. Personnel shall ensure the flash is not activated on the camera.

Personnel using Kodak DC-50/120 shall verify alkaline batteries are properly installed and the flash is not active on the camera.

Personnel using digital cameras (Sony DKC ID1, Kodak DC-50/120 shall not use these cameras in the presence of a hydrogen leak or an oxygen enriched atmosphere (readings greater than 23 percent O₂).

NOTE

Task Team Leader (TTL) for final inspection is PH-H. Additional personnel (listed below) may be added to the final inspection team with CTC, Launch Director, and Safety concurrence.

JSC Level II (1) PH-H (2) SFOC ETM (1)

OMI S6444 J04 APPROVED

80-1	Assen	nble following	final inspe	ction team members:
	PH-H SFOC LMSS	PH-H EETM SC LSS Safety	(1) (1) (2) (1) (1)	
80-2	Final i		n perform v	walkdown of SSV and associated facilities as
				NOTE
•	Followin	ig substep may	be not perf	ormed with TTL concurrence.
į	of opport	0-2 and 80-3 artunity. Images hall be inputted	must be tal	only items. Images are to be taken of targets en with 35 mm and digital cameras. Digital
	1.			3, photograph SSV points of opportunity sing 35 mm. Record data.
				Roll No
				Negative No
				Work order No
				Sub Step Not Performed:
في ۱۳۵۰	2.	Reference Talopportunity u	bles 80-2 ar sing digital	id 80-3, take digital image of SSV points of camera.
		Description:	Final Insp	ection Team
				SPC No
5 * w I				Disc/Frame Nos:
	3.	See Figures 80 external surface	0-1 through ce temperat	80-4, measure and record (deg F) SSV ures using IR gun(s)/scanners.

NOTE

The following substep references inspection areas. However, inspection shall not be limited to these areas. Inspection shall be of entire SSV and specific areas of concern as defined by the TTL, CTC, or Launch Director.

4. Visually inspect:

- Orbiter aft engine compartment external surfaces for condensation and ice formations.
- ET TPS surfaces which cannot be observed by the OTV system.
- Specific areas of concern as determined by the TTL, CTC, or Launch Director.

OMRSD S00U00.020-A-1

OMRSD S00U00.020-C-1

OMRSD S00U00.020-D-1

Final Inspection complete. Verify no constraints to continue. Forward description(s) of debris found to SFOC QC for entry into Processing Debris / FOD Database.

TTL (PH-H)

<u>Ma</u> Da

SFOC-ETM

Date_1-16-03

Date 1-16-53

િકી માન

80-4 Operation - Final Inspection complete.

TRI ...

OMI S6444 J04 APPROVED

03-15-2002 APPROVED

Table 80-1 Final Inspection Team Walkdown Stay Times

255 Ft Level - 5 Minutes

- LO₂ Ogive and Barrel acreage
- GO₂ Pressurization Line
- LO₂ Tank Cable Tray
- Visible LH SRB surfaces
- GO₂ Vent Ducts

215 Ft Level - 20 Minutes

- ET GH₂ 7 inch Vent Assembly
- ET acreage (between -Z and -Y axis)
- GO₂ vent area
- Orbiter tiles
- Visible SRB surfaces
- Inter tank-to-LO₂ Barrel splice

195 Ft Level - 10 Minutes

- LO₂ Feed Line
- ET/Orbiter Bipods (side and bottom view)
- Y ET/SRB forward attachment (bottom view)
- -Y ET/SRB aft attachments (top view)
- Inter tank splice areas (LO₂ and LH₂)
- ET acreage (between -Y and +Z axis)
- Orbiter tiles
- Visible LH SRB surfaces

135 Ft Level - 10 Minutes

- LH₂ ET/Orbiter Umbilical
- -Y ET/SRB C/T
- -Y Vertical Strut
- LO₂ Feed Line
- ET acreage between -Y axis and +Z axis
- ET/Orbiter attachments (top view)
- Visible LH SRB surfaces
- Orbiter aft fuselage



Table 80-1 Final Inspection Team Walkdown Stay Times 0 Level - 30 Minutes

- LH₂ Aft Dome
- ET acreage around +Z axis
- ET acreage around -Z axis
- LO₂ Feed Line
- LH₂ Feed Line
- ET/Orbiter attachments Bottom view
- ET/Orbiter LH2 and LO2 Umbilicals
- T-0 LH₂ and LO₂ Umbilicals
- Space Shuttle Main Engines (SSME)
- Orbiter tiles
- ET/SRB aft attachments
- Visible SRB surfaces
- SRB ignition overpressure sound suppression water troughs

*** End of Table 80-1- Final Inspection Team Walkdown Stay Times ***

OMI S6444 J04 APPROVED

Notes

Table 80-2 Final Inspection Team - Telephotos

TELEPHOTÓS - 255 FT LVL

Camera Orientation **Photo**

GO₂ Vent Ducts Horizontal

LO₂ Acreage Vertical

TELEPHOTOS - 215 FT LVL

Photo Camera Orientation **Notes**

-Y Bipod Ramp Horizontal From RSS

LO₂ P/L Ice Frost Ramps Vertical From RSS; Requires 3-4

shots

GO₂ Seal/Hood Horizontal From haunch & RSS

GUCP Vertical

TELEPHOTOS - 195 FT LVL

Photo Camera Orientation Notes

-Y Bipod Ramp & Jack PAD Horizontal

C/O

TELEPHOTO'S - 135 FT LVL

Photo Camera Orientation Notes

Horizontal LH₂ UMB

-Y Longeron Vertical If needed

Jack Pad Closeouts Horizontal

LH₂ Acreage Vertical

OMI S6444 J04 APPROVED

Table 80-2 Final Inspection Team - Telephotos

TELEPHOTOS - MLP

<u>Photo</u>	Camera Orientation	<u>Notes</u>
LH ₂ UMB	Horizontal	From West
LH ₂ UMB	Horizontal	From NW
EB-7	Horizontal	
EB-8	Horizontal	
LH ₂ Aft Dome	Horizontal	
Third Hard Point C/O	Vertical	
LH ₂ Barrel	Horizontal	From North
SSV Overall	Horizontal	From North
SSV Overall	Horizontal	From East
LO ₂ F/L Bracket & Bellows	Vertical	XT-1973
LO ₂ F/L Bracket	Vertical	XT-1871
LO ₂ F/L Bracket	Vertical	XT-1623
LO ₂ F/L Bracket	Vertical	ST-1377 & XT-1129
LO ₂ F/L Bracket & Bellows	Vertical	XT-1129 & XT-1106 from SE
LO ₂ P/L & C/T	Vertical	From SE

600 MM PHOTOS - 255 FT LVL

<u>Photo</u>	Shutter Speed	<u>Notes</u>
GO ₂ Vent Ducts	1/30	Contingency



OMI S6444 J04 APPROVED

Table 80-2 Final Inspection Team - Telephotos

600 MM PHOTOS - 215 FT LVL

Photo	Shutter Speed	<u>Notes</u>
-Y GO ₂ Seal	1/30	
-Y Bipod Ramp	1/30	Contingency
Jack Pad C/O's	1/4	Difficult if windy
LO ₂ F/L	1/15	
-Y Vertical Strut (Crack)	1/30	

600 MM PHOΤΦS - 195 FT LVL

Photo	Shutter Speed	<u>Notes</u>
-Y Bipod Ramp	1/30	Contingency

600 MM PHOTOS - 135 FT LVL

<u>Photo</u>	Shutter S	peed	<u>Notes</u>
LH ₂ UMB	1/30		
-Y Vertical Strut (Crack)	1/60		
LO ₂ F/L Bellows	1/15		Contingency



Table 80-2 Final Inspection Team - Telephotos

600 MM PHOTOS - MLP

Photo	Shutter Speed	<u>Notes</u>
LH ₂ UMB	1/30	From West
LH ₂ UMB	1/30	From NW
LH ₂ UMB	1/30	From East
LH ₂ UMB Actuator C/O	1/15 or 1/30	From North standing next to water pipe
LO ₂ UMB	1/5	Lower Inboard
LO ₂ UMB	1/8	Inboard
LO ₂ F/L Bracket & Bellows	1/15	One photo to include XT-1978 & XT-1973
LO ₂ F/L Bracket	1/15	XT-1871
LO ₂ F/L Bracket	1/15	XT-1623
LO ₂ F/L Bracket	1/15	XT-1377
LO ₂ F/L Bracket	1/30	One photo to include XT-1129 & XT-1106
LO ₂ F/L Bracket	1/30	From SE corner; One photo to include XT-1129 & XT-1106
Jack Pad C/O's	1/15	From SE corner
Ice Frost Ramps or Pal Ramps	1/15 or 1/30	Contingency
LH ₂ UMB Inboard	1/15	From East
+Y Longeron	1/15 or 1/30	Contingency
-Y Longeron	1/15	Contingency



OMI S6444 J04 APPROVED

Table 80-2 Final Inspection Team - Telephotos

WIDE ANGLE PHOTOS - 255 FT LVL

<u>Photo</u>	Camera Orientation	<u>Lens</u>	<u>Notes</u>
LO ₂ Tank	Vertical	35-70 mm	
GO ₂ Vent Ducts	Horizontal	35-70 mm	

WIDE ANGLE PHOTOS - 215 FT LVL

<u>Photo</u>	<u>Camera</u> <u>Orientation</u>	<u>Lens</u>	<u>Notes</u>
Overall GH ₂ Vent Line	Horizontal	35-70 mm	
Orbiter Nose, ET -Y Side	Horizontal	35-70 mm	
Orbiter Nose, ET -Y, +Z Side	Horizontal	35-70 mm	From RSS
Forward Half of Vehicle	Vertical	28 mm	From RSS
Entire Orbiter	Vertical	. 28 mm	From RSS

WIDE ANGLE PHOTOS - 195 FT LVL

<u>Photo</u>	Camera Orientation	<u>Lens</u>	Notes
Aft Part of SSV, LH Wing	Vertical	35-70 mm	
Orbiter Fwd Section, Upper LH ₂ Tank	Vertical	35-70 mm	
Bipod, -Y, +Z Intertank Area	Horizontal	35-70 mm	

Table 80-2 Final Inspection Team - Telephotos

WIDE ANGLE PHOTOS - 135 FT LVL

<u>Photo</u>	<u>Camera</u> <u>Orientation</u>	<u>Lens</u>	Notes
Orbiter Aft Section	Vertical	35-70 mm	
Lower LH ₂ Tank & LH SRB	Vertical	35-70 mm	

WIDE ANGLE PHOTOS - MLP

Photo	Camera Orientation	<u>Lens</u>	Notes
Overall Orbiter Left Side	Vertical	28 mm	
ET -Y, +Z Quadrant	Vertical	28 mm	
ET -Z Side	Vertical	28 mm	
ET +Y, +Z Quadrant	Vertical	28 mm	
Overall Orbiter Right Side	Vertical	28 mm	
ET Aft Dome	Horizontal	35-70 mm	
-Z Side of LO ₂ T-0; RCS Stinger	Horizontal	35-70 mm	
+Z Side of LO ₂ T-); RCS Stinger OMS Nozzle	Horizontal	35-70 mm	
-Z Side of LH ₂ T-0; RCS Stinger	Horizontal	35-70 mm	
+Z Side of LH ₂ T-0; RCS Stinger OMS Nozzle	Horizontal	35-70 mm	
Overall SSME Cluster	Horizontal	50 mm	-Y Side
SSME No. 2	Horizontal	50 mm	
SSME No. 1, -Z Side	Horizontal	50 mm	
SSME No. 3	Horizontal	50 mm	
Overall SSME Cluster	Horizontal	50 mm	+Y Side

Table 80-2 Final Inspection Team - Telephotos

WIDE ANGLE PHOTOS - MLP (continued)

<u>Photo</u>	Camera Orientation	<u>Lens</u>	<u>Notes</u>
LO ₂ UMB Area	Horizontal	35-70 mm	
LH ₂ UMB Area	Horizontal	35-70 mm	
ET/ORB UMB & ORB Lower Surface	Horizontal	28 mm	From under ET

^{***} End of Table 80-2 Final Inspection Team - Telephotos ***

Table 80-3 Reduced Final Inspection Team Photos

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - 255 FT LVL

<u>Photo</u>	Camera Orientation	<u>Lens</u>	<u>Notes</u>
GO ₂ Vent Ducts	TELE	Horizontal	

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - 215 FT LVL

<u>Photo</u>	Camera Orientation	<u>Lens</u>	<u>Notes</u>
-Y Bipod Ramp	Horizontal	TELE	From RSS
LO ₂ P/L Ice/Frost Ramps	Vertical	TELE	From RSS; 2 photos required
GO ₂ Seal/Hood	Horizontal	TELE	From RSS
GUCP	Vertical	TELE	
Fwd Half of SSV	Vertical	28 mm	From RSS
Entire Orbiter	Vertical	28 mm	From RSS

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - 195 FT LVL

<u>Photo</u>	Camera Orientation	<u>Lens</u>	<u>Notes</u>
-Y Bipod Ramp & Jack	Horizontal	TELE	

Table 80-3 Reduced Final Inspection Team Photos

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - 135 FT LVL

Photo	Camera Orientation	<u>Lens</u>	<u>Notes</u>
LH ₂ UMB	Horizontal	TELE	
Orbiter Aft Section	Vertical	35-70 mm	

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - MLP DECK

<u>Photo</u>	Camera Orientation	<u>Lens</u>	<u>Notes</u>
LH ₂ UMB	Horizontal	TELE	From West
ET Aft Dome	Horizontal	TELE	
Aft Hard Point Closeout	Vertical	TELE	
LH ₂ Tank	Horizontal	TELE	From North
LO ₂ Tank	Horizontal	TELE	From North
LO ₂ Tank	Horizontal	TELE	From East
LO ₂ F/L Bracket Bellows	Horizontal	TELE	XT - 1978 & XT - 1973
LO ₂ F/L Bracket	Horizontal	TELE	XT - 1871
LO ₂ F/L Bracket	Horizontal	TELE	XT - 1623
LO ₂ F/L Brackets	Horizontal	TELE	XT - 1377 & XT - 1129
LO ₂ F/L Brackets & Bellows	Horizontal	TELE	XT - 1129 & XT - 1108; from SE
LO ₂ P/L & C/T	Horizontal	TELE	From SE
Overall Orbiter Left Side	Vertical	28 mm	
ET -Z Side	Vertical	28 mm	
Overall Orbiter Right Side	Vertical	28 mm	
Overall SSME Cluster -Y Side	Horizontal	28 mm	

OMI S6444 J04 APPROVED

Table 80-3 Reduced Final Inspection Team Photos

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - MLP DECK (continued)

Overall SSME Cluster +Y Horizontal

28 mm

Side

ET/Orb UMB & Orbiter

Horizontal

28 mm

From under ET

Lower Surface

*** End of Table 80-3 - Reduced Final Inspection Team Photos ***

*** End of Operation 80 ***

OMI S6444 J04 APPROVED

OPERATION 90	LO ₂ /LH ₂	Drain M	Ionitoring

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 4.0

NOTE

This operation is contingent upon progression of launch countdown and is performed after start of cryo (LO₂/LH₂) loading and subsequent launch scrub, FRF, or WCDDT.

Operation Not Performed: ME

1/16/0

NOTE

This operation monitors the External Tank external surfaces during LO_2/LH_2 drain operations from time of detanking until 1.5 hours after LO_2/LH_2 low level sensors read dry via OTV 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 068/168, 069/169, 070/170, and 071/171.

Noted requirements satisfied by this operation: OMRS S00E00.021

90-1 Record start date/time (GMT) of LH₂ and LO₂ Tank Drain.

LH₂ Drain Start Date _____ Time ____ GMT


LO₂ Drain Start Date ______ GMT

ETM _____ Date

ET OF

90-2 CVM1 JTV1 223

From start of LO₂ Tank Drain and LH₂ Tank Drain until respective LO₂/LH₂ low level sensors read dry, monitor ET external surfaces including LO₂ Feed Line, LH₂ Feed Line, LH₂ Recirculation Line, LH₂ Aft Dome and manhole covers, LH₂/LO₂ Umbilicals, TSM LH₂/LO₂ Umbilicals via OTV cameras. No cryogenic liquid or excessive vapors allowed.

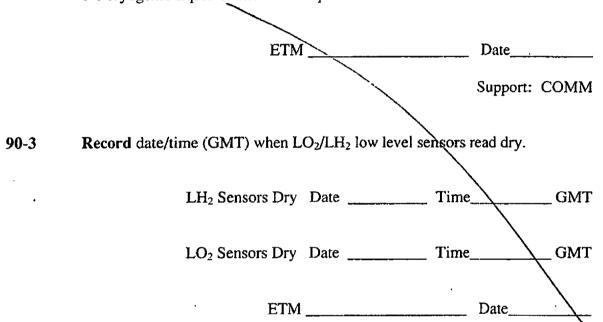


L	S	

LISA ECIDIMATADA ANTI DO DINO

TOP/WAD Deviation

			<u> </u>	1		.
United Space Alliance	Įε	Dev No. <u>9 o / o</u>	1	DILS No. 9	8/24	Page 1 of 1
TOPWAD No.	R	EV/CHG/VER	In Famil			se Code
S6444		J04		Request	ing or Causing	Org Reason 10-Tech Chg 20-Proc C
			XNMA		E	30-Auth Error 40-Rewrite 20
First Use SRB BI-	X)ET 093	GSE		I	STS)-
Effectivity: ORB /FLT		FRCS/PC	p /FLT		SSM	ME /FLT
Affected: OMRS/ACOMC/OMP	Design Req1	ts Haz Step	(\$)	☐PPE		X internal Review Req.
Contractor OPR		Contractor Te	t Conductor		GOVYOPR	OD 14-42
	6-04-02		lizarii		14041	CTXIII 06-04-0
Contractor Test Project Engineer		Other SEC				Erigiriger
Contractor Safety		Other				rector or Contractor Chief TC
Page Number: 90-3 Step	Number:	90-4				
Add the following new step	:					
90-4.1 Monitor the ET GO	X Vent Lar	nd area after	GOX Ve	nt Hood retr	action using	z cameras no.
013/113, 060/160, 0			1		•	•
Record results below			}	•	•	U
Results No Mi	cción te	00 6	1.0- 1	Lin In	c than it	WiciRla DAMA
recsures 14 O 1411	S Z N Y Y E	poor f	\mathcal{L}	WU IP	Z XII N	1 1
,		ETM	KK	ewer	Date //	visiBLe DAMM9 16/07
Later 1						7
_						
Originator (print)	SPDMS ID	Phone	Organ	zation Date		IX Perm ☐ Temp
R Brewer	706345	1-4429	FTM		04/2002	Perm Temp

 

WC 150 USA

SEP 18 102

90-5

90-6

223 JTV1 90-4 CVM1

SEE DEV

Monitor ET external surfaces including LO₂ Feed Line, LH₂ Feed Line, LH₂ Recirculation Line, LH₂ Aft Dome and manhole covers, LH₂/LO₂ Umbilicals, TSM LH₂/LO₂ Umbilicals via OTV cameras for 1.5 hours after LO₂/LH₂ low level sensors have read dry. No dryogenic liquid or excessive vapors allowed. Record date (time (GMT) when monitoring complete.

LH ₂ Complete	Date	Time		GMT
LO ₂ Complete	Date	Time		GMT
ETM			Date	
12.114			Date	
			Support:	СОММ
see dev				
Completion of this operation satisf	fies noted requiremed	nts.		
OMRSD S00E00.021		`		
OMRSD 600 E 600,641	-)			
Operation - LO ₂ /LH ₂ Drain Moni	toring complete.			
	1			_

*** End of Operation 90 ***

OMI S6444 J04 APPROVED

OPERATION 100 Console Securing

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N
Duration (Hrs): 0.5

100-1

CTIF TBC 136 TBC CTC 232

OTV support for ET thermal protection system evaluation no longer required.

100-2

CTIF JYVR 138

Perform the following:

- 1. Turn off video recorders
- 2. Remove tape cartridges.
- 3. OTV support no longer required.

Support: COMM

100-3

CTIF CVM1 222 CVM2

Secure consoles by setting all monitors to "Off" position.

Report completion.

NOTE

Perform next step only after a successful launch.

100-4

CTIF

Remove photo processing laptop computer from Firing Room.

Not Performed: 1-16.03

ETM. RBrewer Date 1/16/03

100-5

CTIF TBC 136 232 TBC **CTC**

Firing Room 2, ice frost monitoring area securing complete.

100-6

Operation 100 - Console Securing complete.

*** End of Operation 100 ***

OMI S6444 J04 APPROVED

OPERATION 110 Summary Tape

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 18.0

NOTE

Observations/concerns observed during count are typically recorded on the summary tape real-time (trouble tape).

110-1 CICE

After launch or launch scrub, prepare a summary tape to include observations/concerns noted during count.

110-2 Operation Summary Tape complete.

ETM RBrewn Date 1/17/03

*** End of Operation 110 ***

OMI S6444 J04 APPROVED

OPERATION 120 Post Drain Walkdown

Shop: SE

Cntrl Rm Console: NA

OPR: ETM Zone: PAD A/B Hazard (Y/N): Y Duration (Hrs): 2.0

NOTE

Post drain walkdown performed only after start of cryo (LH₂/LO₂) loading and subsequent launch scrub.

Operation Not Performed: 05 1/16/03

WARNING

Personnel working at heights greater than 4 feet and within 6 feet of an unguarded edge shall wear a safety harness with a lanyard secured to an approved tie off point, substantial structural member (no handrails) or a properly installed life line.

Personnel shall wear hardhats and flame retardant coveralls while performing post drain walkdown.

NOTE

Post drain walkdown typically commences approximately 1.5 hours after LH₂/LO₂ low level sensors read dry.

Post drain walkdown performed in support of a 24 hour scrub turnaround is typically coincident with the L-20 hour pre-launch walkdown for the ensuing launch attempt.

	NOTE	
	nanical Engineer (PH-H) or designee shall function as team g personnel are walkdown optional participants:	
NASA Engr	(4)	
SFOC Engr	(2)	;
LMSSC-LSS	(1)	
Boeing LSS	(1)	
SFOC Safety	(1)	

120-1 NASA Lead ET Mechanical Systems Engineer (PH-H) verify essential personnel on station, properly attired, and ready to proceed with post drain walkdown.

Essential Personnel	
NASA Engineering (PH-H)	1
SFOC Engineering (ETM)	1

NOTE

"Hands-on Investigation" is applicable only to those areas which are not understood or fully defined and which cannot be adequately evaluated otherwise.

 
- 120-2 Perform post drain walkdown as follows:
 - 1. Visually inspect ET TPS exterior surfaces after detanking and warmup (approximately T + 4 hours after drain is initiated) from the MLP, FSS, and RSS as access permits.
 - 2. Perform hands-on investigation of all areas suspected of violating Doc: NSTS 08303 (LI) NSTS PROGRAM ICE/DEBRIS INSPECTION CRITERIA (LI)

OMRSD S00E00.031

3. Photograph any vehicle / facility concerns observed.

Disc/Frame Nos: NO._____

Walkdown complete. All discrepancies identified. No constraints to continue. Forward description(s) of debris found to SFOC QC for entry into Processing Debris / FOD Database.



120-4 Operation Post Drain Walkdown complete.

*** End of Operation 120 ***

OMI S6444 J04 APPROVED

OPERATION 130 Post Launch Walkdown

Shop: SE

Cntrl Rm Console: NA

OPR: ETM
Zone: PAD A/B
Hazard (Y/N): Y
Duration (Hrs): 3.0

NOTE

Do not perform this operation after launch scrub.

Operation Not Performed: ///

WARNING

Personnel working at heights greater than 4 feet and within 6 feet of an unguarded edge shall wear a safety harness with a lanyard secured to an approved tie off point, substantial structural member (no handrails) or a properly installed life line.

Personnel participating in walkdown shall wear hardhats and flame retardant coveralls.

NOTE

NASA ET Mechanical Engineer (PH-H) or designee shall function as team leader. Following personnel are walkdown optional participants:

NASA Engr (3) SFOC Engr (2) LMSSC-LSS (1) Boeing LSS (2)SRB ELE (1) Thiokol-LSS (1) SFOC Safety (1) Pad Mgmt Rep (1)

1-16-03

03-15-2002 APPROVED

130-1 NASA (PH-H) verify following personnel on station, properly attired, and ready to proceed with post launch walkdown.

Es	sential Personne	ı
NASA	PH-H	1
SFOC	ETM	1

NOTE

Post Launch Walkdown must be performed prior to washdown and Pad being opened for normal work.

- 130-2 Perform Post Launch Walkdown as follows:
 - 1. Ref Table 130-1, visually inspect post launch pad/area to identify any lost flight or ground systems hardware and debris sources.
 - 2. Ref Table 130-2, document/SIMS photograph launch PAD area configuration.

Description: Post Launch Walkdown

OMRSD S00U00.010-1

	SPC No
Dica/Erama Nace	

Walkdown complete. Debris sources and lost flight hardware identified. No constraints to continue. Forward description(s) of debris found to SFOC QC for entry into Processing Debris / FOD Database.

PH-H	Date	
ETA (Data	

130-4 Operation - Post Launch Walkdown complete.

Table 130-1 Post Launch Walkdown Ins	pection Areas
Record mission info, PAD, date, and time	•
STS <u>/67</u>	PAD (A'
Date Jan. 16, 03	Time/3:00 HRS
SRB Hold-down posts (HDP)	
Inspect for damage, stud hang-up Epon shin blast covers, erosion, missing hardware, deb	
- MINOR DAMAGE / DEBRIS -	
- MINOR DAMAGE / DEBRIS - No STUD 'HANgup' IN 8	HDP's.
	•
MLP	Deck .
SRB aft skirt purge lines SRB T-0 umbilicals Tail service masts (TSM's) MLP deck	
<u>195 F</u> (Level
Orbiter access arm (OAA)	

1-16-03

Table 130-1 Post Launch Walkdown Inspection Areas

215 Ft Level - GH2 Vent Line/GUCP

Latch position Loose cables Damage from SRB plume Damage to the QD

255 Ft Level - GO2 Vent Arm, Ducts, Hood

Seals Hood windows, doors, latches

Fixed Service Structure (FSS)

Cable tray covers Signs Hydraulic leaks Slidewire baskets

PAD Apron/Acreage

Vehicle hardware and/or flight TPS materials Facility debris

Table K-1 PAD Apron/Acreage Items Location MiNOR Debris in Acreage Areas

*** End of Table 130-1 - Post Launch Walkdown Inspection Areas ***

OMI S6444 J04 APPROVED

Table 130-2 Post Launch Photos (MLP, FSS, PAD, Apron, Pad Acreage)

MLP 0-level

1 Ea HDP No. 1, 2, 5 & 6 (HDP shoe and Epon shim)

1 Ea HDP No. 3, 4, 7 & 8 (blast cover down to HDP base)

I Ea SRB T-O umbilical

1 Ea overall view SRB exhaust cutouts\

Any unusual or debris-related damage to the facility; sound suppression water pipes, TSM's cracks in MLP deck, witness panels, handrails, etc.

Any flight hardware debris (tiles, SRB ordnance fragments) Any facility debris (nuts, bolts, cable tray covers, etc.)

<u>FSS</u>

Close-ups of GUCP and latching mechanism Overall views of GO₂ vent hood/ducts, if damaged Any flight hardware or facility debris Any unusual or debris-related damage to the facility

PAD Apron/PAD Acreage

Any flight hardware or unusual facility debris objects

Any unusual or debris-related damage to the PAD (such as missing brick in the flame trench), perimeter fence, etc.

*** End of Table 130-2 - Post Launch Photos (MLP, FSS, PAD, Apron, Pad Acreage) ***

*** End of Operation 130 ***



OPERATION 140 Film Review

Shop: SE .

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 15.0

NOTE

This operation may be not performed after launch scrub.

Operation 140 Not Performed: NA

NOTE

Analysis of Pad Debris Inspection Results determines priority for film review. All critical film (as determined by the Debris Team) must be reviewed as soon as possible after launch and no later than 36 hours prior to entry (of the Orbiter into the earth's atmosphere).

- 140-1 Review and analyze all engineering launch (and flight) film to:
 - Identify any debris damage to the SSV
 - Identify flight vehicle or ground system damage that could affect Orbiter flight operations of future SSV launches.

OMRSD S00U00.011-1

140-2 Operation - Film Review complete.

ETM R Brewer Date 1/18/03

plete.

ETM R Brewer Date 1/18/03

*** End of Operation 140 ***

OPERATION 145 IR Camera Removal

Shop: PH-H

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 2.0

WARNING

Hard hats required on the Pad when SSV is not present.

CAUTION

Exercise care to avoid dropping equipment, fasteners, etc from RSS roof to prevent damage to equipment or injury to personnel. All tools must be tethered.

NOTE

IR Camera removal from RSS Roof site may be not performed in launch scrub turnaround scenarios.

145-1 Remove IR camera at RSS Roof Site as follows.

- 1. Remove fasteners (2 pl) from camera housing front. Retain fasteners for reinstallation when front cover is installed.
- 2. Install camera housing front cover using previously removed fasteners (2 pl). Tighten fasteners (2 pl) wrench tight.

Power cable is live. Care should be exercised when connecting power cable to avoid electric shock.

CAUTION

Do NOT allow back cover to exert undue force on cables when opening/rotating back cover.

- 3. Rotate camera housing back cover into open position by removing bolts with flat washers (20 pl). Retain bolts/washers for reinstalllation.
- 4. Disconnect:
 - · Power cable
 - Pan & tilt cable
 - Controller cable
 - OTV coaxial cable
- 5. Unlock spring pin at lower, left to release IR camera Unit in camera housing. Remove IR Camera Unit from camera housing by carefully sliding it out the back opening of the camera housing. Support IR Camera Unit during removal.
- 6. Rotate camera housing back cover into closed position. Do not pinch cables. Secure back cover by reinstalling bolts/flat washers (20 pl). Tighten bolts wrench tight.



Isopropyl Alcohol is flammable and is a skin, eye and respiratory tract irritant that affects the central nervous system. Ensure adequate ventilation, avoid inhalation of vapors and do not use near heat, sparks or open flame. Skin contact may cause redness and pain eye contact will cause severe eye irritation and may result in permanent damage. Inhalation of vapors in high concentrations has a narcotic effect on the central nervous system. Personnel shall wear N-Dex nitril gloves and chemical splash goggles. When working at eye level or above wear a face shield over goggles.

WS002.a 05-22-01

- 7. Clean IR Camera Unit lens plate using (1) roll 8305-00-519-3144 Rymple cloth dampened with (4) ounces 6810-00-543-7915 Isopropyl alcohol.
- 8. Route IR Camera Unit to VAB 3K1 for refurb/checkout.

NASA PH-H Date Date

Not Performed: N/A

NOTE

IR Camera removal from Camera \$ite 2 may be not performed in launch scrub turnaround scenarios.

- 145-2 Remove IR camera from Camera Site 2 as follows.
 - 1. Remove bolt(s) from camera housing front. Retain bolt(s) for reinstallation when front cover is installed.
 - 2. Install camera housing front cover using previously removed bolt(s). Tighten bolt(s) wrench tight.

 
Power cable is live. Care should be exercised when connecting power cable to avoid electric shock.

CAUTION

Do NOT allow back cover to exert undue force on cables when opening/rotating back cover.

- 3. Loosen screws (8 pl) securing camera housing back cover using Phillips screwdriver. Rotate camera housing back cover to open position. Retain bolts/washers for reinstallation.
- 4. Disconnect:
 - Power cable
 - Pan & tilt cable
 - Controller cable (2 pl)
 - OTV coaxial cable
- 5. Unscrew set screw(s) at lower, left/right to release IR camera Unit in camera housing. Remove IR camera Unit from camera housing by carefully sliding it out the back opening of the camera housing.

 Support IR camera Unit during removal.
- 6. Coat camera housing back cover O-ring with a single coat of (1) tube/jar 6505-00-133-8025 Petroleum Jelly, Vaseline (or equivalent).
- 7. Rotate camera housing back cover into closed position. Do not pinch cables. Secure back cover by installing screws (8 pl). Tighten screws wrench tight using Phillips screwdriver.





TOP/WAD Deviation

United Space Alliance		Dev No <i>14</i>	5-0		LS No <i>10288</i>	8	Page 1 of 2
TOP/WAD No.	R	EV/CHG/VER	Xin	Family	. Commenting and	Cause C	
S6444		J03	□°	ut of Family	Requesting or C (8,D,E,G,H,L,N,O	P.O.S.T.V)	Reason 10-Tech Chg 20-Proc Chg 30-Auth Error 40-Rewrite
			□N	MA	E		20
First Use SRB BI-	ET	GSE				XSTS-107	7
Effectivity: ORB /FLT		FRCS/PC	1			SSME	/FLT
Affected: OMRS/ACOMC/OMP	Design Req't	s Haz Step	(S)		PPE		ternal Review Req.
Contractor OPB	1-15-13	Contractor Tes	Cond	uctor	1/2/	OPR	MPH-HZ
Contractor Test Project Engineer	75 5	Other	CHI		4-Gov	t Project Engin	
	.~	1			-03		
Contractor Safety		Officer	R	ue	Gov'	t Test Director	or Contractor Chief TC
			<u> </u>				
Page Number: 145-5 Step	Number	: 145-2					
Add the following:							
Page Number: 145-5 Step	Number	145_2 0					
Tage Number: 143-3 Step	i validoti.	145-2.7					
After this step, add the follow	ing new st	teps:				٠	
145.2 D-44							
145-3 Post Launch of SRBs:							
At Hanger "AF", durin	ng open as	sessment, de	 ocum	ent / pho	tograph as re	quired.	
7/1/	1/51	110			•	-	
SPC No. 36/	1901	//2 Disc / I Date <u>/</u>	ram	e No			
PH-H AT Melo	EGGS-	Date /	-20	2-03			
1 10 All		Dato					
145-4 Post Landing Orbiter /	Runway	Inspection:					
1 701	1 0.	1.1 1	_		0.1%		* * *
1. Photograph debris as walkdown.	nd any flig	ght hardware	lou	nd during	g Orbiter post	landing o	debris
warkdowii.							
2. Photograph any obse damage mapping.	ervations	found during	Orb	iter post	landing debri	is inspecti	on and TPS
SPC No		Disc / I		a Na			:
DI C 140.		DISC / I	ratile	→ INU	···· нт		
РН-Н		Date	ļ				
17/03 4		_					
ETM		Date					
Odelesta ()	000110 :=	To:		···			
Originator (print) R. Brewer	SPDMS ID ZQ6345	Phone 1-4429	1 1	organization ETM	Date 01/17/200	i	Perm Temp
1. 0101101	トなくりょう		<u>! </u>	_ 1 171	101/17/200		Temp-Recycle

Isopropyl Alcohol is flammable and is a skin, eye and respiratory tract irritant that affects the central nervous system. Ensure adequate ventilation, avoid inhalation of vapors and do not use near heat, sparks or open flame. Skin contact may cause redness and pain eye contact will cause severe eye irritation and may result in permanent damage. Inhalation of vapors in high concentrations has a narcotic effect on the central nervous system. Personnel shall wear N-Dex nitril gloves and chemical splash goggles. When working at eye level or above wear a face shield over goggles.

WS002.a 05-22-01

- 8. Clean IR Camera Unit lens plate using (1) roll 8305-00-519-3144 Rymple cloth dampened with (4) ounces 6810-00-543-7915 Isopropyl alcohol.
- 9. Route IR Camera Unit to VAB 3K1 for refurb/checkout.

NASA PH-H	Date
	A
USA ETM	

24 JAN 103 VIII. OI TR DEV

*** End of Operation 145 ***

Not Performed: Rhewar CTM-SE 1-24-03



03-15-2002 APPROVED

OPERATION 150	Final	Report
---------------	-------	--------

Shop: SE

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): **0.5**

		NOTE
	This operation may be not perform	ed after launch scrub.
		Operation 150 Not Performed:
	·	
150-1	Assemble final report by attaching Reference each to this step.	ng following reports to this OMI.
	Post Launch PAD Assessment	
	SRB Assessment	
	Launch Film Review Launch Day Video Review	
	Orbiter Landing Assessment	
	ET Separation Review	
150-2	Final report assembly complete.	
	E	ГМ Date
150-3	Operation - Final Report comple	te.
	-	
	*** End of O	peration 150 ***

WAD NO. 56444-J04 TASK NO./SEQ. NO. Global **DEVIATION INDEX** PERMANENT ☐ TEMPORARY TEMP - RECYCLE QC/ PP&C DEV NO. SEQ/ STEP DATE REMARKS **EFFECTIVITY** GC/01 JAN 1 4 103 8E016011201 5.1 65/02 AND 1 - 03 5.1 107 4102/028

U	15	

TOP/WAD Deviation

United Space Alliance		ev No. <u>GC-</u>		DILS No.LO	-	<u> </u>	age 1 of 1
TOP/WAD No.	R	EV/CHG/VER	In Family	Decuest	Causine	se Code	Danner
S6444		J04	X Out of Fa	amily (8,D,E,G,)	g or Causing (10-1	Reason son Chg 20-Proc Cho with Error 40-Rewrite
	i		□NMA		E	30-4	20
First Use SRB 81-	X ET 093	GSE		•	STS		
Effectivity: ORB /FLT		FRCS/PC	D /FLT		SSV	ME /FLT	
Affected: OMRS/ACOMC/OMP	Design Req'ts	Haz Step	(s)	□PPE		X Internal	Review Req.
Contractor OPR		Contractor Te	t Conductor		Gov't OPR		1/PH·HZ
K Brewer	01-10-03				Armin	while	Kin 1/10/0:
Contractor Test Project Engineer		OW JES		-10-03	Coby't Project E	ngineer	,
Colympion Carry BORING TNT		Other E.M	Blue		Gov't Test Dire	ertor or Cor	ntractor Chief TC
Drave I will	01-13-03		ma	1-10-03	Corresion	30101 04 007	THE TO
Leggert	0,700	10000	The state of the s	muuin 3	·		
1 2499011							
	Global Cha	ingel .		and him the start	Ş		
	Page Numb		Step Nu				
	0-10		5.1				
	90-3		90-5				
					-		
Add the following:							
OMBOD 0005000 (41.1	. 49						
OMRSD S00E000.641-1 at	i mese steps.						
	- · · · · · · · · · · · · · · · · · · ·	· · · · · · · · · · · · · · · · · · ·		 	· ···········		
	•						•
:							
							!
1							
Originator (print)	SPDMS ID	Phone	Organiza	tion Date	D	Perm	☐ Temp
R. Brewer	ZQ6345	1-4429	ETM	01/10		_	Recycle /

	S	A
		سيستنيب

TOP/WAD Deviation

United Space Alliance		Dev No.	5C-02	DILS No. 10	12487	Page 1 of 1
TOPWAD No.		REV/CHG/V	ER In Family		Caus	e Code
S6444	-	J04	X Out of Fa	Requesting	ng or Causing C	rg Reason
	ļ	- •	□NMA	(15,0,5,0,		30-Auth Error 40-Rowr
First Lien Copp pu	VICT 848			<u>. </u>	<u>E</u>	20
First Use SRB BI-	X ET 093	GS			STS-	
Effectivity: ORB /FLT			CS/POD /FLT		SSM	E /FLT
Affected: MOMRS/ACOMC/OM	P Design Red	n'ts Haz	: Step(s)	PPE	X	Internal Review Req.
Contractor OPR Q Q			for Test Conductor		Gove OPR	/ N/ PH-H
	01-10-03				Azmin	Let Nin Islat
Contractor Test Project Engineer		Other	ECHECK	- 10+03	Gov't Project Er	ngineer OLiu
T PULSOCE MOLES TONORINGE TO	Nt.	Other	N Photo		Court Toot Dime	tor or Contractor Chief TO
	1/13/0		Dan!	1/10/03	GOAT LEST DILEC	aur or Contractor Chief 10
Lugar K. 1 St.	טוניוןי	21/4	mun	10.5	\ <u></u> -	
Legett						
•		and the second second second	TOTAL SEL William Inc. Fung.		-ar	
	Global C		, 11 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1			
1	Page Nur	nber	Step Nui	nber		
Ī	0-10		5.1			
	50-6		50-11			
i	50-13	,,,	50-24			
Delete the following:						
OMRSD S00FB0.360-1 f	rom these ste	ps.				
				,		
			1			
Originator (print)	SPDMS ID	Phone	Organiza	tion Date	₩	Perm Temp

Computer Generated December 16, 2002

⊠ PERM		TATION INDEX TEMPORARY TEM	IP RECYCLE	ECYCLE S6444 REV: J CHG:04 (DMI		
DATE/TIME	: 06/06/2002	07:56:26		TASK NO.	/SEQ. NO. 98	
DEV NO.	SED/ STEP	EFFECTIVITY	PP&C	DATE	REMARKS	
90-01	90 4	,	×	2002-06-05		
·						
· · · · · · · · · · · · · · · · · · ·						
··········						
<u>~~</u>						

L

C] PERMANENT	DEVIATION INDEX TEMPORARY	1 2	TEMP · RE		WAD NO. SG444 / TO3 TASK NO./SEQ. NO. 145
DEV NO.	SEQ/ STEP	EFFECTIVITY	P	QC/ P&C	DATE	REMARKS
145/01	145-2	57S-107	(SP6) 1020)	24 JAN 703	P.145-5 .
			·			
						<u> </u>
<u> </u>						
						/
		`				

. - -



700			
PEVISION S	144/504	EFFECTIVITY ET-116	t-sub-s
mber 01-FRI-12050	2 Page 40-6	secrop-step 40-2	Eng Appropriat On
JT-FR1-12050	2 700	1 4apa 10-C	Julia E
		3/113 was "SW	" Midorf
- Ch	and cam al	•	· · · · · · · · · · · · · · · · · · ·
		now "NW	
king Number	Page	Sed/Op - Step	Eng Approval
			<u> </u>
	\ 		<u> </u>
	\		· · · · · · · · · · · · · · · · · · ·
			···········
Lina Nember	Page	Seq/Op - Step	Eng Approval
king Number			
	· · · · · · · · · · · · · · · · · · ·		
. · Al	Page	Seq/Op - Step	Con Annual
cking Number	Page	эеуор - энер	Eng Approval
		·	
,	· · · · · · · · · · · · · · · · · · ·		
cking Number	Page	Seo/Op - Step	Eng Approval
	•		
<u>, , , , , , , , , , , , , , , , , , , </u>			
29-510 Rev 4-02			
			net

Pen and Ink Change Record

(OB)	JUL	10
UC		7
Integri Space	e Alla	nco

initer Librace Alliance			
REVISION	56444 / Jo4		3, ET-113
acking Number 02-FR3-070	0902 Page 60-8	Seq/Op-Step Table	60-/ Eng Approval
AJd Ca	me, a 063/163	Spec Greations 6 5-30	.02
	SRB AND ORB		enstered 5/2402-
EÜLR	LHZ FIREDETER	TIDN SYSTEM (B	LICHER FAPEL)

Fracking Number	Page	Seq/Op - Step	Eng Approval
racking requires	1.440		
		·	
mber	Page	Seq/Op - Step	Eng Approval
Tracking Number	Page	Sep/Op - Step	Eng Approval
Tracking Number	Page	Seq/Op - Step	Eng Approval
The state of the s			Fild Shinoadi
	, and the same of		



Pen and Ink Change Record

SION		EFFEC	TIVITY	
cking Number	Page	Seq/O _I	- Step	Eng Approval
			,	
acking Number	Page	Seq/C	p - Step	Eng Approval
		· · · · · · · · · · · · · · · · · · ·		
acking Wymber	Page	Seq/	Op - Step	Eng Approval
racking Number	Page	Sea	Op - Step	Eng Approval
Tacking Homber	r ago			
	4.44			
		<u>-</u> .		
Tracking Number	Page	Sec	yOp - Step	Eng Approval
		·		